

General Information

Date & Time: 08, Nov, 2025 09:00

Make	Honda	Model	City
YOM	2018	Odo Meter Reading	70,512
Registration No.	NBC2609	Chassis No.	PADGM6620JV408911
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



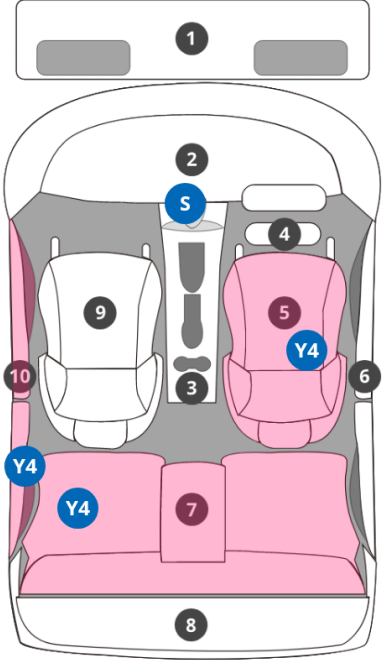
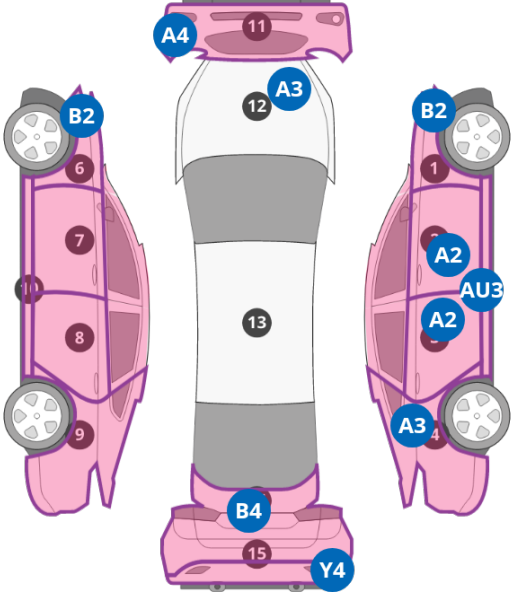
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.1	88	94	85
2	Boot Lid	90.6	97	79	96
3	Roof	104.6	114	111	89/105
4	Left Front Fender	122.3	136	107	124
5	Left Front Door	91.2	91	83	100
6	Center Panel Left				
7	Left Rear Door	93.8	103	88	91
8	Left Back Panel	98.7	107	93	96
9	Right Front Fender	143.0	154	127	148
10	Right Front Door	98.4	99	93	104
11	Center Panel Right				
12	Right Rear Door	102.2	99	100	108
13	Right Back Panel	113.3	104	106	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Rear Trim - Grime - Large / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Modified - Large / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Modified - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Modified - Small / Bonnet, Headlight - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>incomple tools/ possible flooding/ no LTO plate/ with jack and spare tire/ with warranty booklet/ abnormal noise when activating the aircon/</p>