

General Information

Date & Time: 17, Nov, 2025 18:29

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	9,498
Registration No.	FAS3169	Chassis No.	MHFAA1BYXR0034099
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



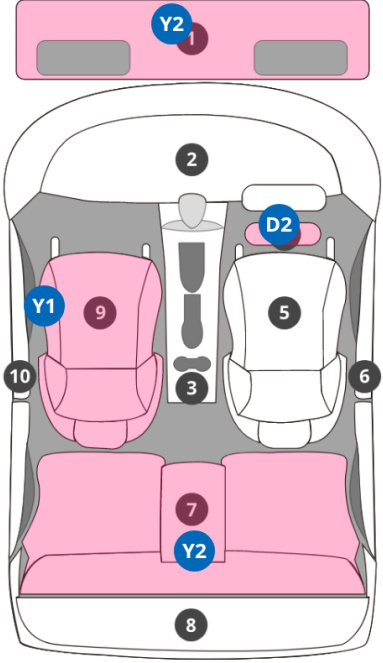
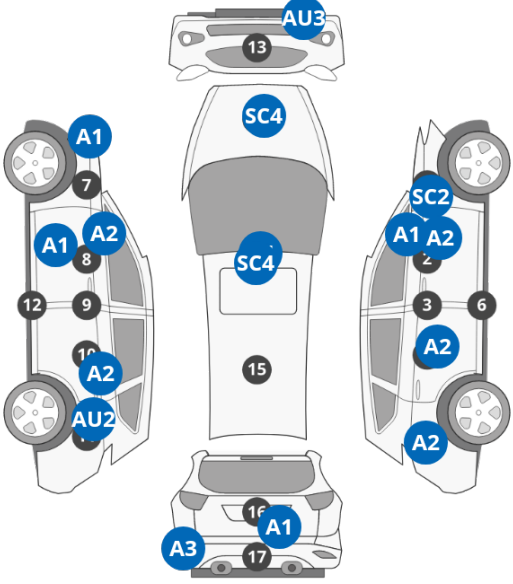
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	109	101	122
2	Boot Lid	102.7	100	113	95
3	Roof	122.2	142	135	107/105
4	Left Front Fender	106.5	114	97	109
5	Left Front Door	128.3	115	123	147
6	Center Panel Left				
7	Left Rear Door	116.0	114	112	122
8	Left Back Panel	128.0	135	104	145
9	Right Front Fender	106.6	115	105	100
10	Right Front Door	120.0	122	119	119
11	Center Panel Right				
12	Right Rear Door	114.0	115	112	115
13	Right Back Panel	117.0	130	101	120

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Minimal / Room Mirror - Missing - Yes	Remarks (R) Front Fender, Molding - Rust, Corrosion - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Rust, Corrosion - Large / Front Windshield - Scratch, Stone chip - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Roof - Rust, Corrosion - Large / (L) Rear Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, corrosion on front bumper and headlight