


General Information

Date & Time: 12, Nov, 2025 15:06

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	72,618
Registration No.	DBP9046	Chassis No.	MHKAA1BC6RJ024072
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition

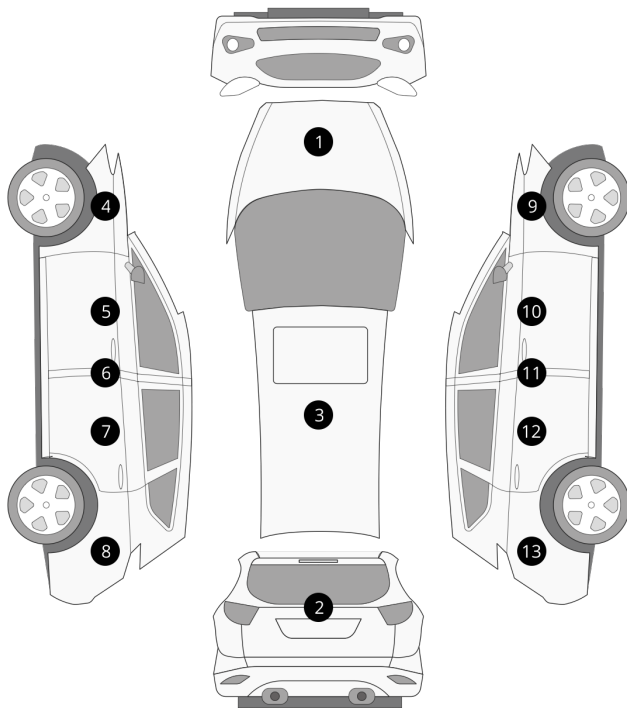


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	111	104	104
2	Boot Lid	82.1	80	86	81
3	Roof	75.3	74	75	80/73
4	Left Front Fender	323.6	344	332	295
5	Left Front Door	462.6	1,110	141	137
6	Center Panel Left				
7	Left Rear Door	141.6	173	122	130
8	Left Back Panel	149.3	150	128	170
9	Right Front Fender	95.9	110	93	85
10	Right Front Door	107.0	110	106	105
11	Center Panel Right				
12	Right Rear Door	101.5	96	98	110
13	Right Back Panel	104.4	118	95	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

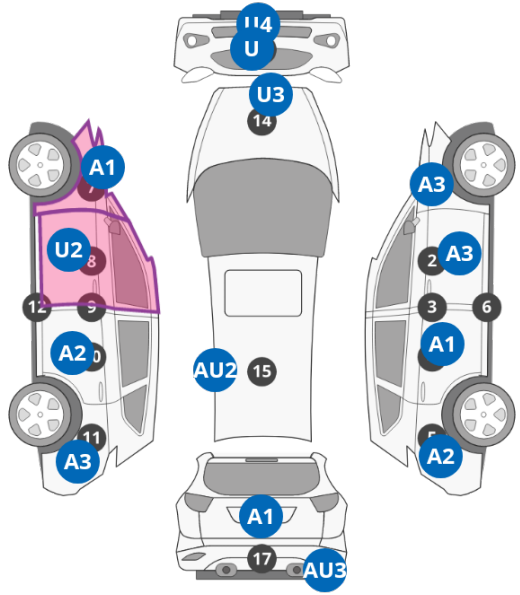Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Minimal / Ceiling - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Dent - Large / Bonnet, Headlight - Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Dent - Small / Roof - Scratch & Dent - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with reverse camera/with jack/No tools/No spare key/No warranty booklet /cross member support issue