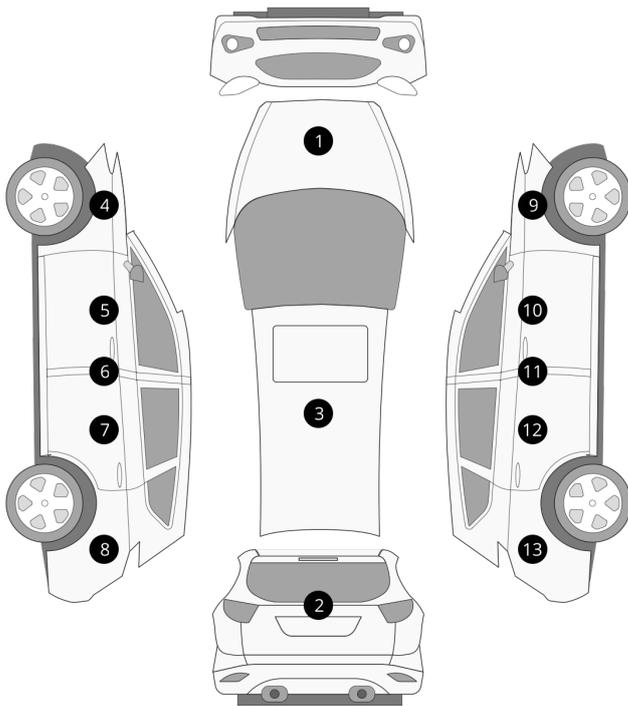


## General Information

Date & Time: 17, Nov, 2025 10:15

<b>Make</b>	Toyota	<b>Model</b>	Veloz
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	21,048
<b>Registration No.</b>	GAK7882	<b>Chassis No.</b>	MHFAB1BY0P3051051
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



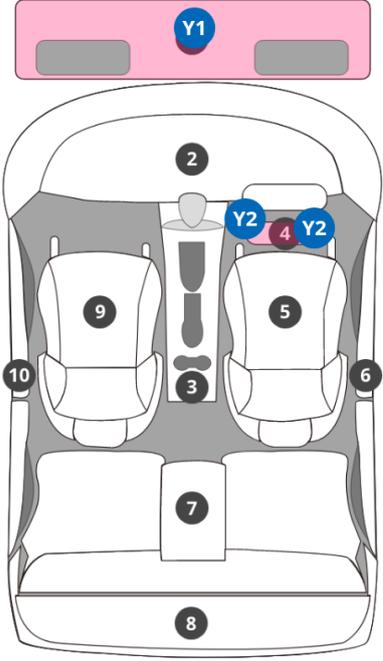
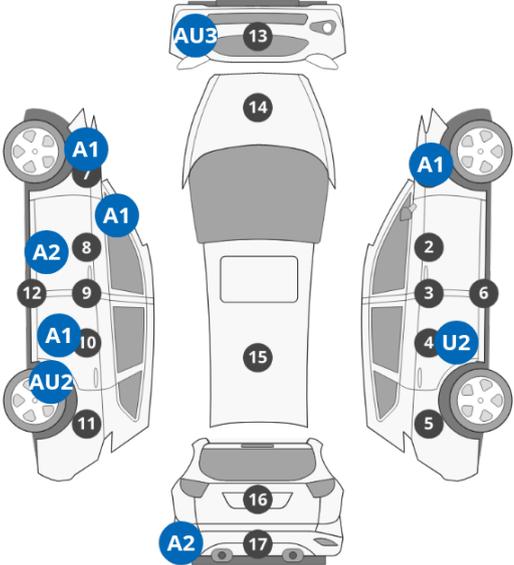
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	118	100	120
2	Boot Lid	108.1	102	125	97
3	Roof	110.0	120	112	100/108
4	Left Front Fender	105.3	105	104	107
5	Left Front Door	132.6	127	130	141
6	Center Panel Left				
7	Left Rear Door	132.0	112	141	143
8	Left Back Panel	122.6	131	123	114
9	Right Front Fender	99.2	100	100	98
10	Right Front Door	139.0	144	138	135
11	Center Panel Right				
12	Right Rear Door	135.6	125	128	154
13	Right Back Panel	119.3	109	122	127

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Crack rear right reflector. Parking sensor sonar missing. Infulltainment system issue. Without warranty booklet,tools and seat cover. With spae tire and jack. 1 key. With LTO plate.</p>