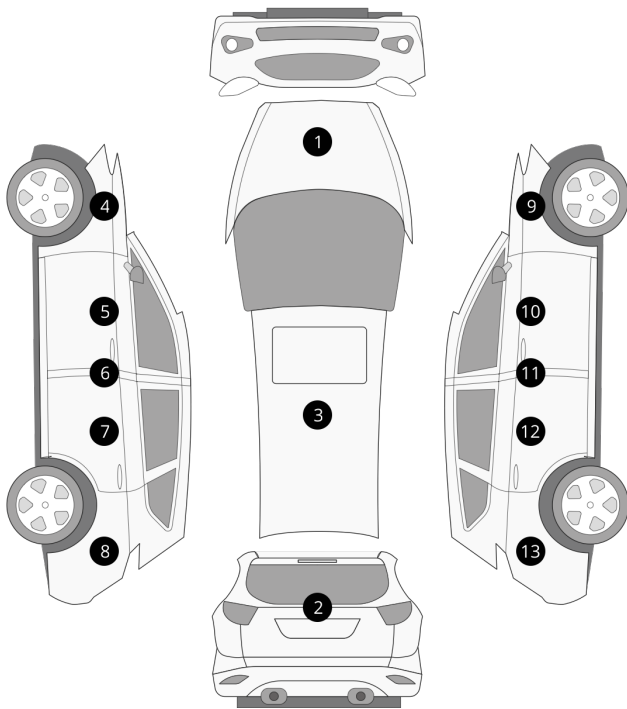


General Information

Date & Time: 17, Nov, 2025 11:42

Make	Suzuki	Model	Ertiga
YOM	2020	Odo Meter Reading	69,285
Registration No.	KAD7118	Chassis No.	MHYNC22S6LJ108141
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



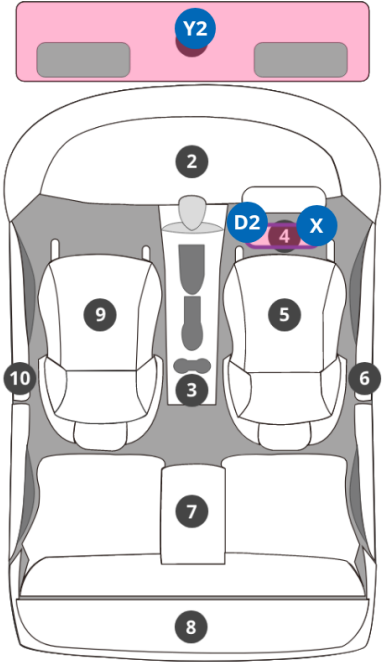
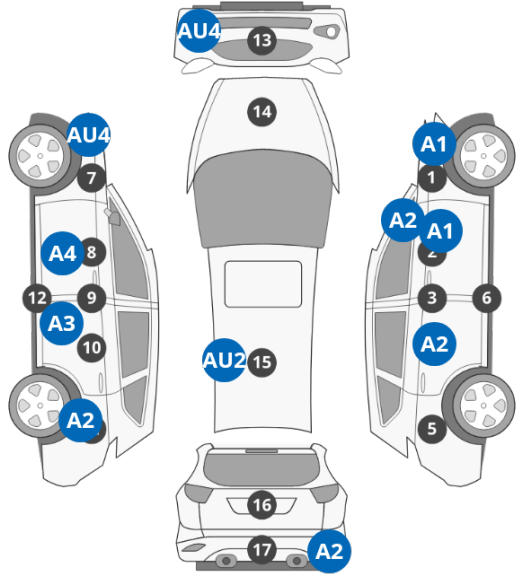
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	86.3	86	85	88
2	Boot Lid	91.3	87	97	90
3	Roof	93.1	90	99	90/94
4	Left Front Fender	85.5	88	83	85
5	Left Front Door	162.3	158	130	199
6	Center Panel Left				
7	Left Rear Door	179.0	215	161	161
8	Left Back Panel	170.0	163	200	147
9	Right Front Fender	90.1	94	87	89
10	Right Front Door	177.6	229	160	144
11	Center Panel Right				
12	Right Rear Door	415.3	239	239	768
13	Right Back Panel	176.3	131	155	243

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

Trunk door issue cannot open. Different shift knob. Cannot confirm if with jack or tools. With warranty booklet, spare tire and leather seat cover. 1 key. With LTO plate.