

## General Information

Date & Time: 17, Nov, 2025 15:56

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	23,850
<b>Registration No.</b>	GAK9288	<b>Chassis No.</b>	MHFAB1BY6P3058408
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Green		

## Body / Panel Condition



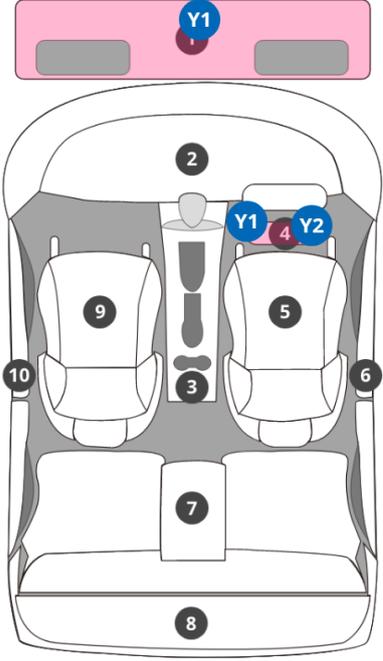
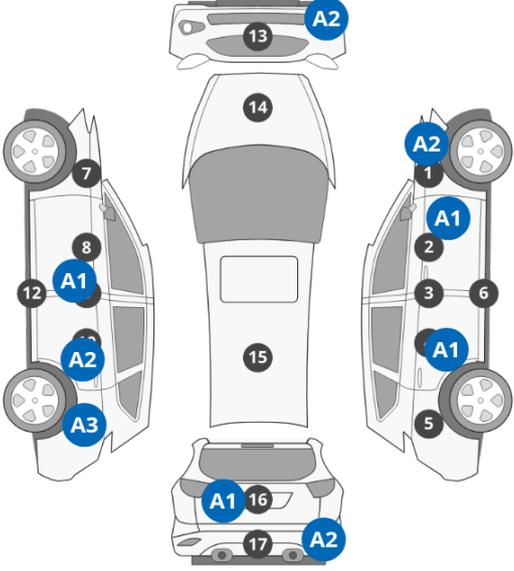
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	103	108	107
2	Boot Lid	116.3	116	130	103
3	Roof	108.7	118	111	101/105
4	Left Front Fender	102.4	95	104	108
5	Left Front Door	110.6	111	108	113
6	Center Panel Left				
7	Left Rear Door	112.6	113	112	113
8	Left Back Panel	109.0	117	106	104
9	Right Front Fender	103.5	109	104	98
10	Right Front Door	107.0	111	103	107
11	Center Panel Right				
12	Right Rear Door	111.3	112	110	112
13	Right Back Panel	109.0	104	103	120

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal</p>	<p><b>Remarks</b> (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire, jack and seat cover. Without tools. 2 keys. With LTO plate. With dashcam but loose wirings.</p>