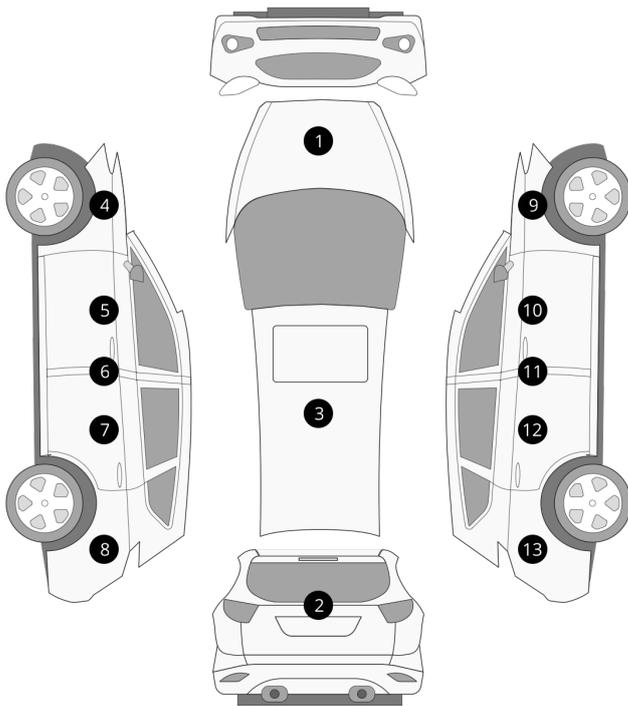


## General Information

Date & Time: 17, Nov, 2025 13:48

<b>Make</b>	Nissan	<b>Model</b>	Navara
<b>YOM</b>	2019	<b>Odo Meter Reading</b>	30,826
<b>Registration No.</b>	GAX2754	<b>Chassis No.</b>	MNTCC2D23Z0061706
<b>CC</b>	2.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Silver		

## Body / Panel Condition



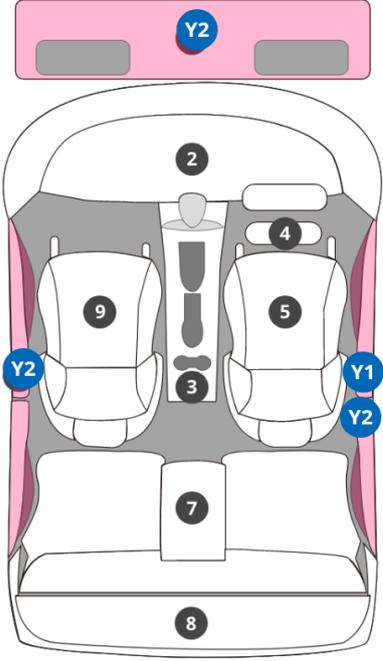
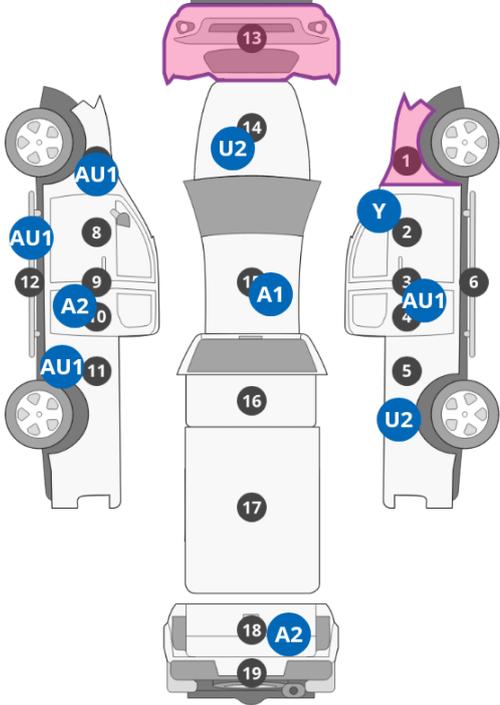
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	162.0	177	148	161
2	Boot Lid	101.8	107	98	101
3	Roof	88.4	81	90	94/88
4	Left Front Fender	140.6	142	150	130
5	Left Front Door	111.8	112	99	124
6	Center Panel Left				
7	Left Rear Door	123.3	141	116	113
8	Left Back Panel	94.2	93	88	102
9	Right Front Fender	167.6	134	168	201
10	Right Front Door	123.3	131	112	127
11	Center Panel Right				
12	Right Rear Door	133.6	125	136	140
13	Right Back Panel	93.9	104	89	89

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Crack - Cracks / (R) Rear Door, Molding - Scratch &amp; Dent - Minimal / (R) Side Gate - Dent - Small / (L) Side Gate - Scratch &amp; Dent - Minimal / Rear Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Roof - Scratch - Minimal / Bonnet, Headlight - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Taillight, reverse light and signal light at rear issue. Reverse camera issue. Horn issue. Right side mirror crack. Without warranty booklet and tools. With spare tire,jack, and seat cover. 1 key. Temporary plate.</p>