

General Information

Date & Time: 24, Nov, 2025 15:33

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	36,063
Registration No.	DBJ6036	Chassis No.	PA1B18F33P4224604
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



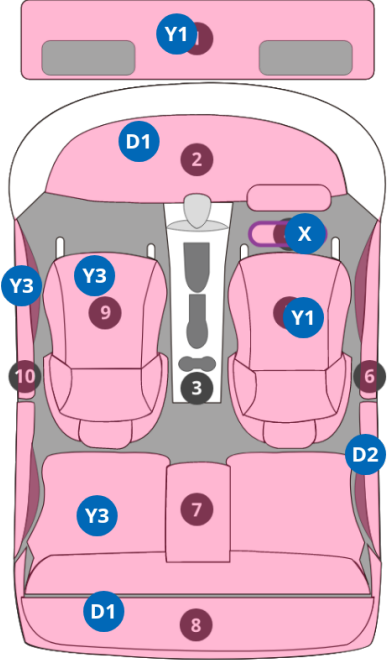
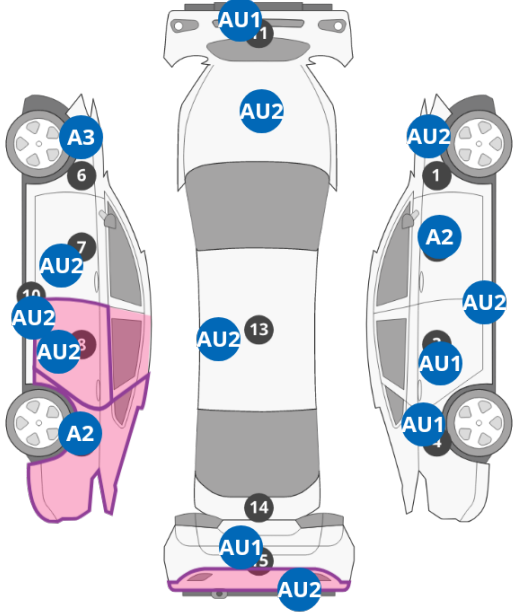
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	158.6	156	155	165
2	Boot Lid	103.6	105	102	104
3	Roof	95.4	97	94	88/103
4	Left Front Fender	149.0	128	138	181
5	Left Front Door	184.0	194	162	196
6	Center Panel Left				
7	Left Rear Door	283.3	275	233	342
8	Left Back Panel	301.0	397	262	244
9	Right Front Fender	112.3	111	109	117
10	Right Front Door	149.3	160	132	156
11	Center Panel Right				
12	Right Rear Door	159.3	161	143	174
13	Right Back Panel	155.6	148	142	177

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Worked - Small / Trunk Room - Worked - Minimal / Dashboard - Worked - Minimal / Ceiling - Grime - Minimal / (R) Front Seat - Grime - Minimal / Mat Other - Missing - Yes</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with Warranty & manual booklet, with spare key, with spare tire, with incomplete tools & jack, no reverse camera, plate light issue, scratches on taillight.</p>