

General Information

Date & Time: 17, Nov, 2025 15:36

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	17,194
Registration No.	CCC1290	Chassis No.	PAEA13TJRPA015948
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



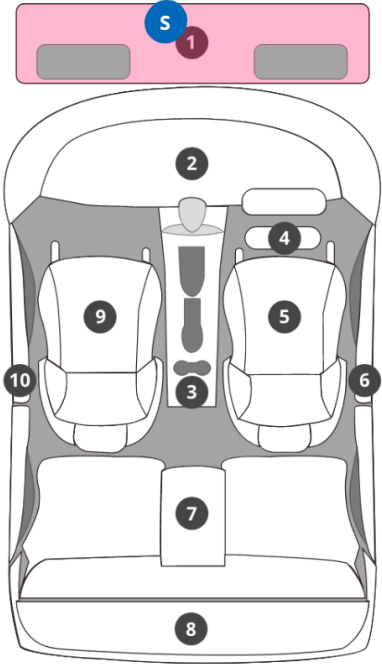
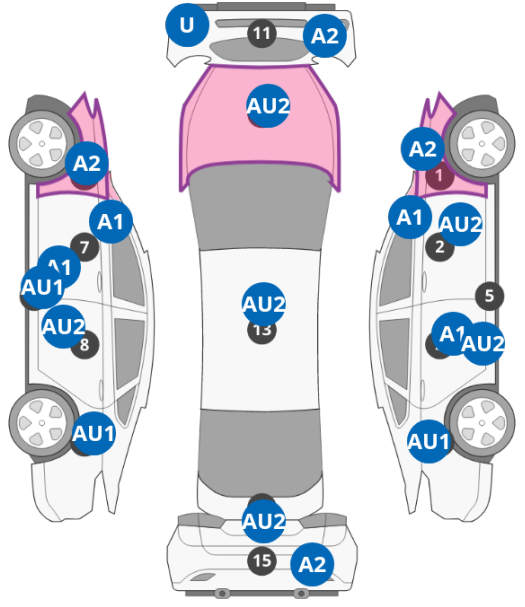
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	130	125	126
2	Boot Lid	103.5	89	110	112
3	Roof	108.2	105	126	101/101
4	Left Front Fender	111.3	116	110	108
5	Left Front Door	110.6	110	110	112
6	Center Panel Left				
7	Left Rear Door	105.0	109	100	106
8	Left Back Panel	122.3	127	121	119
9	Right Front Fender	141.6	150	135	140
10	Right Front Door	117.0	116	114	121
11	Center Panel Right				
12	Right Rear Door	111.0	109	109	115
13	Right Back Panel	120.6	117	121	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, scratch headlight and tail light, no spare key, no reverse camera, foul smell, possible flooded, worn tires, adhesive marks on vehicle, plate and room light issue, headlight issue and tail light issue.