

## General Information

Date & Time: 24, Nov, 2025 12:16

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	19,592
<b>Registration No.</b>	NFR5410	<b>Chassis No.</b>	PA1B18F32R4253255
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



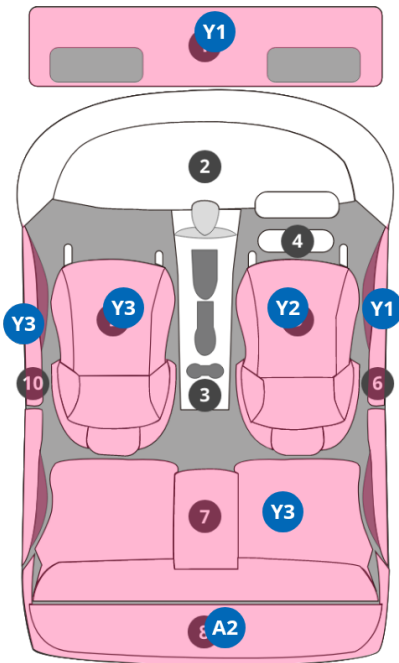
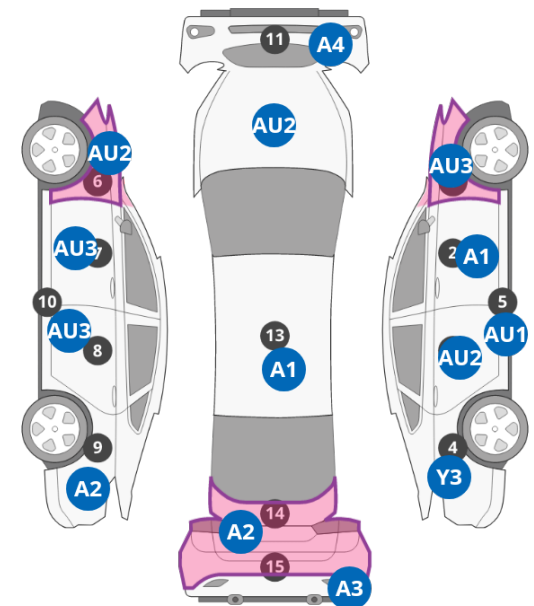
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	129	107	117
2	Boot Lid	179.3	176	167	195
3	Roof	100.4	111	105	94/92
4	Left Front Fender	103.8	105	99	107
5	Left Front Door	108.0	116	108	100
6	Center Panel Left				
7	Left Rear Door	106.3	110	108	101
8	Left Back Panel	118.0	121	118	115
9	Right Front Fender	158.3	139	149	187
10	Right Front Door	105.3	105	105	106
11	Center Panel Right				
12	Right Rear Door	103.2	106	98	106
13	Right Back Panel	111.1	97	110	126

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Crack, Gap - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with spare key/No jack and tools/with warranty booklet/with reverse camera/rear seat issue/right side front driver seat issue/aircon issue/</p>