

## General Information

Date & Time: 19, Nov, 2025 14:45

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	37,246
<b>Registration No.</b>	DBQ2455	<b>Chassis No.</b>	PA1B18F36R4267210
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition




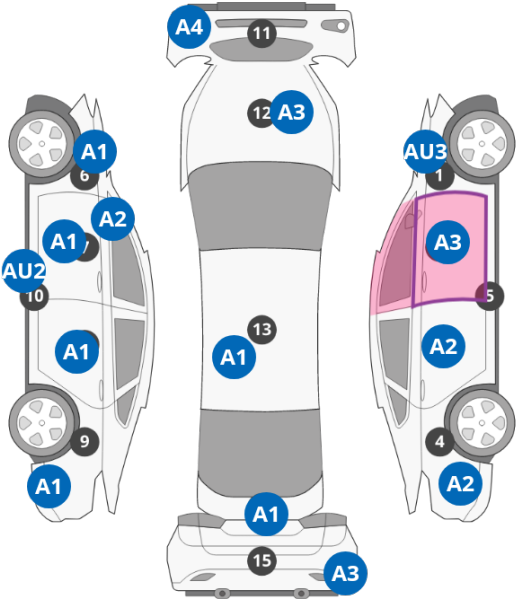
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	117	99	102
2	Boot Lid	105.5	100	101	116
3	Roof	94.6	100	104	84/90
4	Left Front Fender	94.2	96	95	92
5	Left Front Door	102.3	100	102	105
6	Center Panel Left				
7	Left Rear Door	104.0	109	102	101
8	Left Back Panel	111.0	123	107	103
9	Right Front Fender	96.5	97	91	101
10	Right Front Door	169.3	115	282	111
11	Center Panel Right				
12	Right Rear Door	100.3	99	100	102
13	Right Back Panel	99.3	93	98	107

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold;">D</span>
<div style="text-align: center; background-color: #cccccc; padding: 50px;">  <p>No Image</p> </div> <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	<div style="text-align: center;">  </div> <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b>  (R) Front Door - Repair Traces - Yes / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold;">B</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with reverse camera/with jack and incomplete tools/No spare key/with warranty booklet/possible flooding</p>