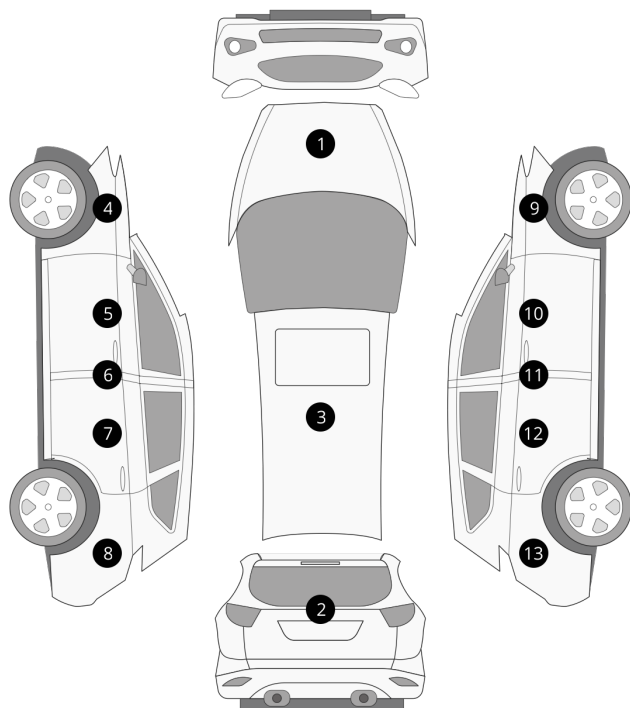


General Information

Date & Time: 17, Nov, 2025 16:40

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	114,086
Registration No.	EAE3942	Chassis No.	MR0JB8DDXM3538026
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



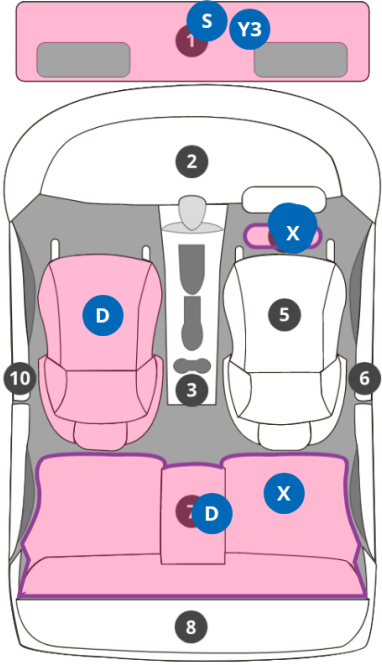
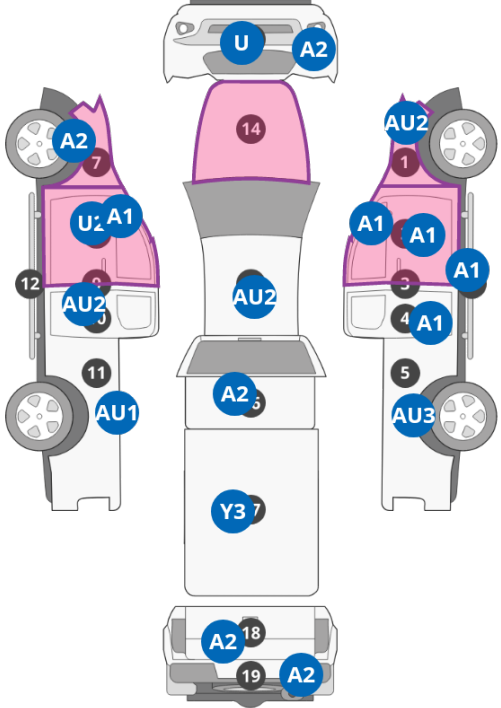
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	129	100	115
2	Boot Lid	89.4	91	91	87
3	Roof	104.5	85	129	110/94
4	Left Front Fender	92.0	84	93	99
5	Left Front Door	100.2	98	101	102
6	Center Panel Left	71.3	71	73	70
7	Left Rear Door	91.3	96	90	89
8	Left Back Panel	100.0	99	103	99
9	Right Front Fender	135.0	153	124	128
10	Right Front Door	96.3	96	98	95
11	Center Panel Right	78.6	66	71	99
12	Right Rear Door	86.3	84	83	91
13	Right Back Panel	102.7	98	95	115

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Overall Interior - Smell - Yes / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Worn - Yes / Rear Seat - Partially Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Small / Cargo Bed Floor - Crack, Gap - Medium / (L) Side Gate - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small / Cab Back Panel - Scratch - Small
Frame Evaluation : C	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO Plate and Sparetire, No tools and Jack, Warranty Booklet, No spare key, No reverse camera, Foul smell, Worn tires and sparetire, Scratch headlight and taillight, reverse light issue, Hazzard light and signal light issue, room light issue, retractable side mirror switch mirror issue.