

## General Information

Date & Time: 09, Dec, 2025 19:29

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	40,781
<b>Registration No.</b>	FAO6060	<b>Chassis No.</b>	PA1B18F37P4212049
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



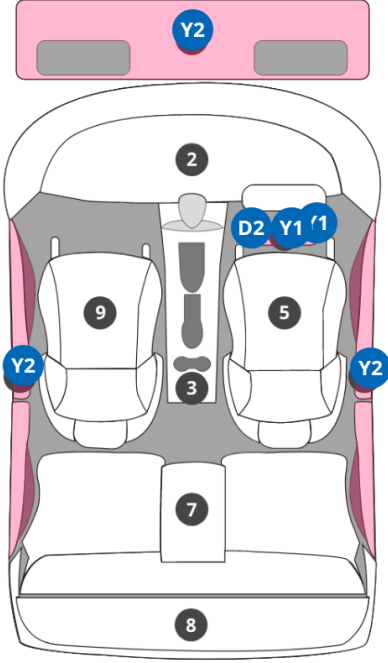
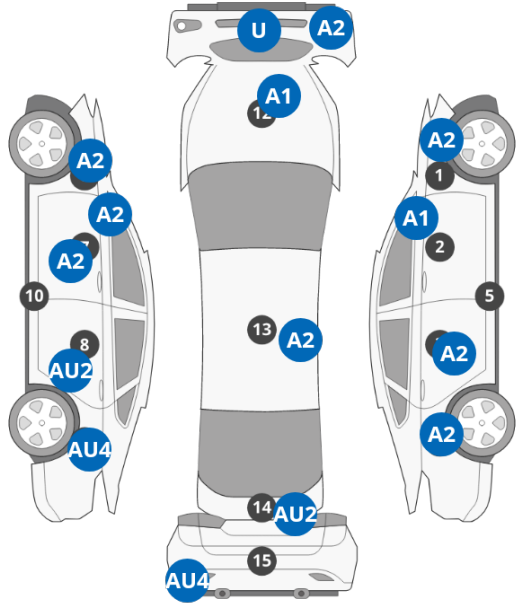
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	119	105	116
2	Boot Lid	112.0	103	113	120
3	Roof	104.4	98	100	112/108
4	Left Front Fender	93.3	98	92	91
5	Left Front Door	98.0	97	100	97
6	Center Panel Left				
7	Left Rear Door	108.0	113	111	100
8	Left Back Panel	115.3	122	102	122
9	Right Front Fender	95.6	92	97	98
10	Right Front Door	100.0	104	100	96
11	Center Panel Right				
12	Right Rear Door	113.3	104	111	125
13	Right Back Panel	108.3	104	106	115

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Mat Other - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Front bumper loose. Engine undercover loose. Gap at front bumper. Rust/corrosion at left rear fender. Without warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTO plate.</p>