

General Information

Date & Time: 10, Dec, 2025 20:03

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Avanza |
| YOM | 2024 | Odo Meter Reading | 6,816 |
| Registration No. | FAQ6905 | Chassis No. | MHFAA1BY7R0028616 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | MPV |
| Colour | Green | | |

Body / Panel Condition



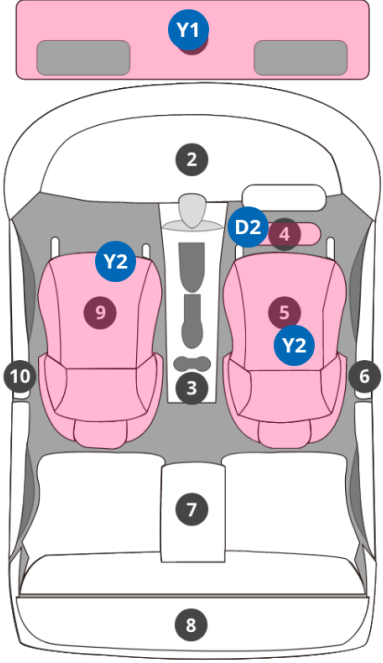
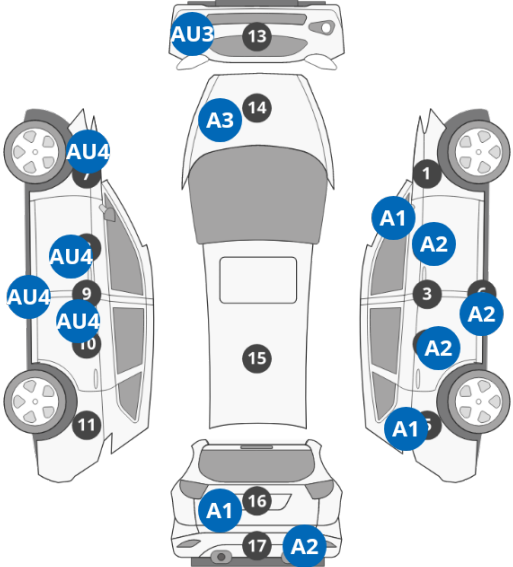
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 113.0 | 106 | 113 | 120 |
| 2 | Boot Lid | 106.4 | 108 | 115 | 96 |
| 3 | Roof | 118.0 | 130 | 132 | 109/101 |
| 4 | Left Front Fender | 106.6 | 110 | 107 | 103 |
| 5 | Left Front Door | 119.0 | 107 | 124 | 126 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 112.6 | 113 | 111 | 114 |
| 8 | Left Back Panel | 117.3 | 133 | 113 | 106 |
| 9 | Right Front Fender | 104.3 | 105 | 105 | 103 |
| 10 | Right Front Door | 117.0 | 123 | 116 | 112 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 111.0 | 110 | 109 | 114 |
| 13 | Right Back Panel | 115.0 | 104 | 110 | 131 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|---|
| Interior Evaluation : A | Exterior Evaluation : E |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal</p> | <p>Remarks (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium</p> |
| Frame Evaluation : D | Functional Evaluation : C |
| <p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p> | <p>Remarks Retractable Mirror - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes</p> |

| |
|---|
| <p>Inspector Notes</p> |
| <p>Damaged left front door, left front fender and left step in panel. Left side mirror damaged and unattached. With warranty booklet, and spare tire. Without tools and jack. 2 keys. With LTO plate.</p> |