

## General Information

Date & Time: 28, Nov, 2025 12:45

<b>Make</b>	Toyota	<b>Model</b>	Veloz
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	1,991
<b>Registration No.</b>	GBJ9769	<b>Chassis No.</b>	MHFAB1BY5R3109125
<b>CC</b>	1.5	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	White		

## Body / Panel Condition



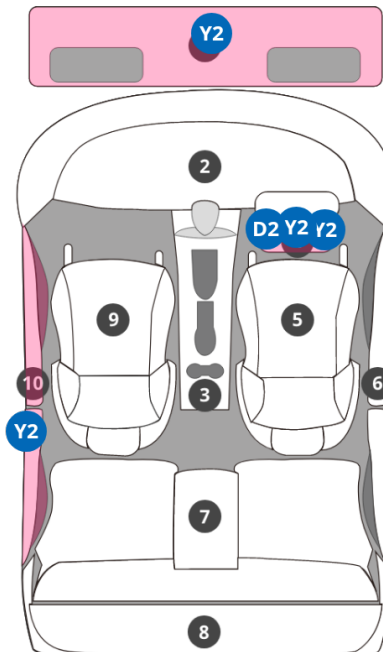
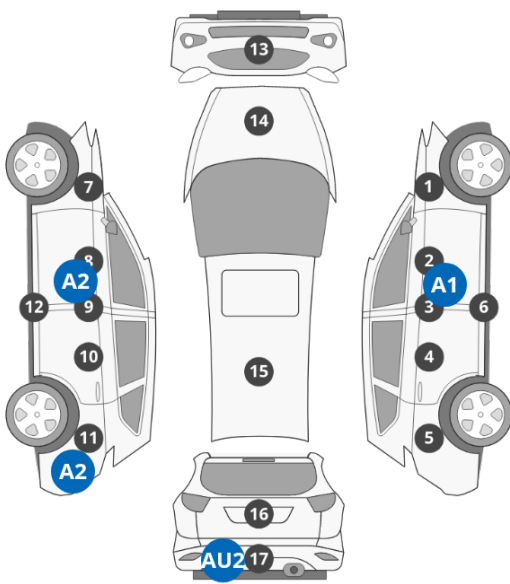
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.0	135	139	131
2	Boot Lid	107.4	110	116	96
3	Roof	126.5	138	134	119/115
4	Left Front Fender	149.3	160	152	136
5	Left Front Door	127.6	126	120	137
6	Center Panel Left				
7	Left Rear Door	114.6	117	113	114
8	Left Back Panel	137.6	148	138	127
9	Right Front Fender	190.6	200	184	188
10	Right Front Door	250.6	254	285	213
11	Center Panel Right				
12	Right Rear Door	203.3	188	169	253
13	Right Back Panel	202.3	204	203	200

## Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Ceiling - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Power window masterswitch issue. Door lock issue. Power folding and retractable mirror issue. Without warranty booklet. With spare tire, jack, tools, and seat cover. 1 key. No LTO plate.</p>