

## General Information

Date & Time: 05, Dec, 2025 15:45

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	8,833
<b>Registration No.</b>	GBJ4402	<b>Chassis No.</b>	MHKAA1BC4SJ035447
<b>CC</b>	1.0	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



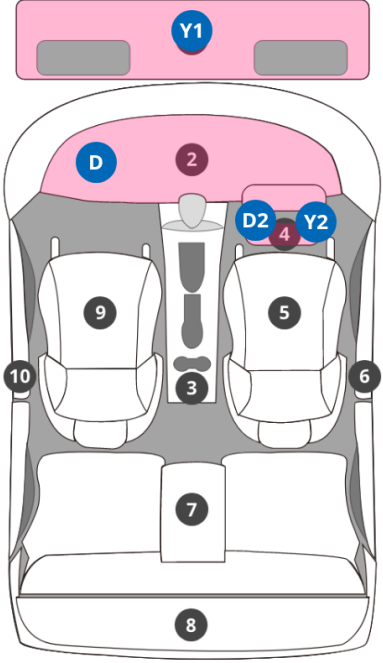
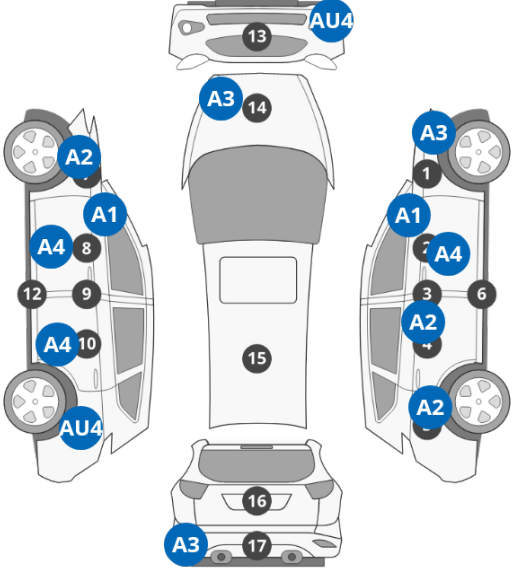
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	114	124	113
2	Boot Lid	104.5	106	108	100
3	Roof	96.8	100	93	100/95
4	Left Front Fender	101.0	103	100	100
5	Left Front Door	104.3	103	101	109
6	Center Panel Left				
7	Left Rear Door	108.6	113	100	113
8	Left Back Panel	97.8	92	103	98
9	Right Front Fender	162.3	157	171	159
10	Right Front Door	153.3	142	153	165
11	Center Panel Right				
12	Right Rear Door	107.3	109	106	107
13	Right Back Panel	99.7	99	98	102

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Defects not found</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire, jack and seat cover. 2 keys. With LTO plate.</p>