

## General Information

Date & Time: 01, Dec, 2025 09:09

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	53,372
<b>Registration No.</b>	NIL5121	<b>Chassis No.</b>	PAEA13TJPPA006373
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



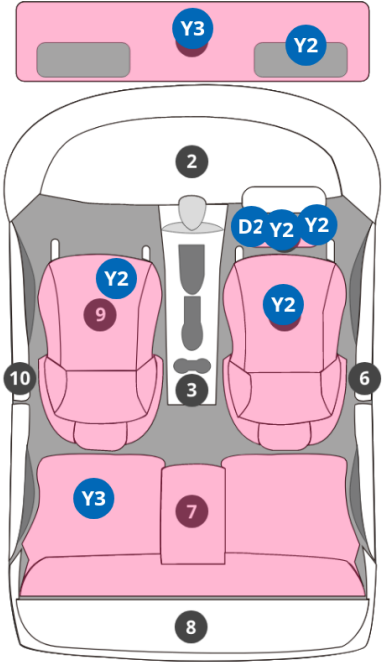
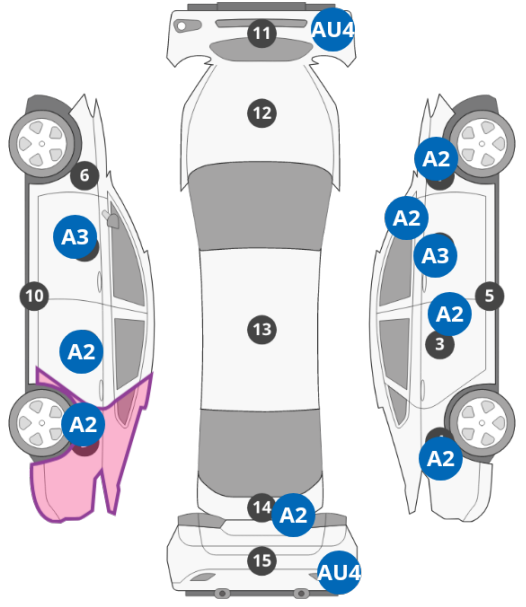
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	162.0	164	151	171
2	Boot Lid	144.0	135	152	145
3	Roof	162.2	163	166	169/151
4	Left Front Fender	159.0	162	148	167
5	Left Front Door	143.0	147	138	144
6	Center Panel Left				
7	Left Rear Door	141.6	149	135	141
8	Left Back Panel	214.3	333	169	141
9	Right Front Fender	152.6	138	144	176
10	Right Front Door	148.0	158	144	142
11	Center Panel Right				
12	Right Rear Door	145.3	134	142	160
13	Right Back Panel	184.6	146	163	245

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a :</b> Cut, Fray <b>d :</b> Loose, Deformed <b>k :</b> Animal Hair <b>s :</b> Smell <b>t :</b> Cigarette Burns <b>x :</b> Defective <b>y :</b> Stain</p>	 <p><b>A :</b> Scratch <b>AU :</b> Scratch &amp; Dent <b>B :</b> Modified <b>C :</b> Corrosion <b>G :</b> Stone chip <b>P :</b> Faded <b>S :</b> Rust <b>SC :</b> Rust &amp; Corrosion <b>U :</b> Dent <b>X :</b> Defective <b>Y :</b> Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (L) Rear Wheel, Cover - Cap Missing - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Maintenance warning lamp. Brake pad at front right side not installed. Crack at left rear bumper. Right taillight missing. Without Warranty booklet, spare tire, jack, tools and seat cover. 1 key. With LTO Plate</p>