

General Information

Date & Time: 26, Nov, 2025 10:13

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	94,067
Registration No.	NHJ2651	Chassis No.	PA1B18F39P4215616
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



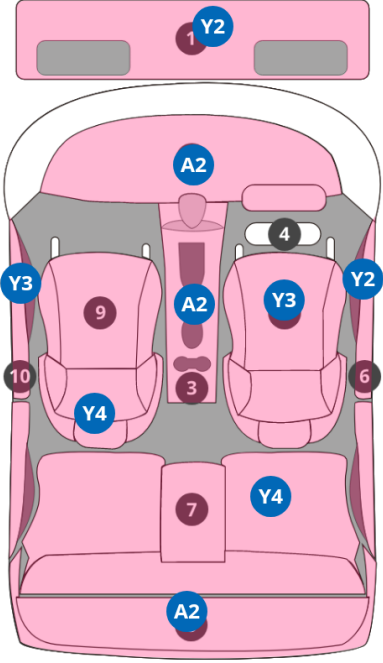
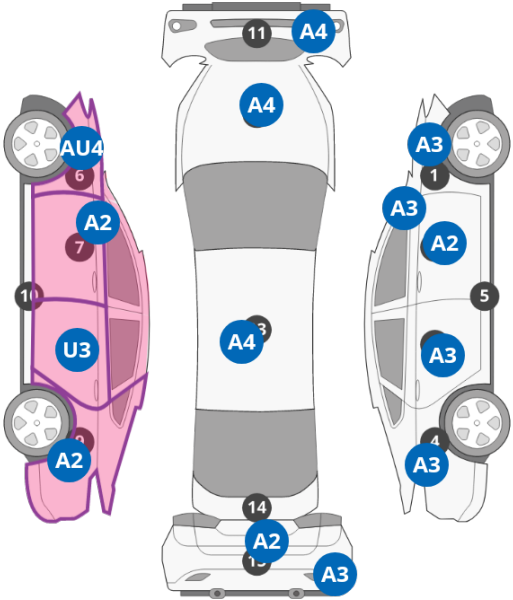
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	122	103	118
2	Boot Lid	109.3	106	110	112
3	Roof	101.7	108	103	94/102
4	Left Front Fender	378.0	154	829	151
5	Left Front Door	155.6	163	153	151
6	Center Panel Left				
7	Left Rear Door	406.3	165	625	429
8	Left Back Panel	208.6	360	141	125
9	Right Front Fender	104.6	108	102	104
10	Right Front Door	104.0	103	102	107
11	Center Panel Right				
12	Right Rear Door	108.1	94	106	124
13	Right Back Panel	103.3	99	98	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Scratch - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Large</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
with LTO plate/with spare tire/No spare key/plate light issue/No jack and tools/No reverse camera/No warranty booklet/rear seat issue/interior dirty/left side front and back door re-painted and front and back fender