

## General Information

Date & Time: 26, Nov, 2025 12:34

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	27,140
<b>Registration No.</b>	NIR2988	<b>Chassis No.</b>	PA1B18F37P4220670
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



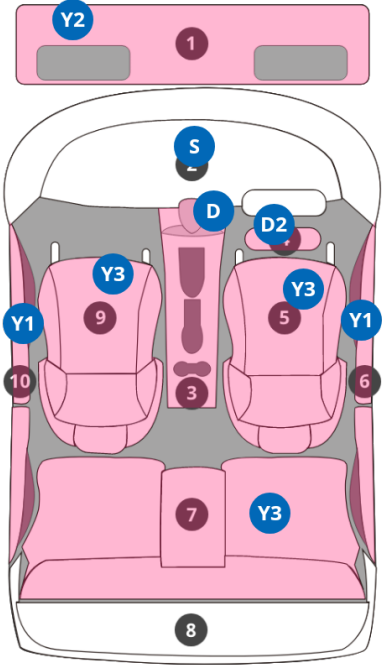
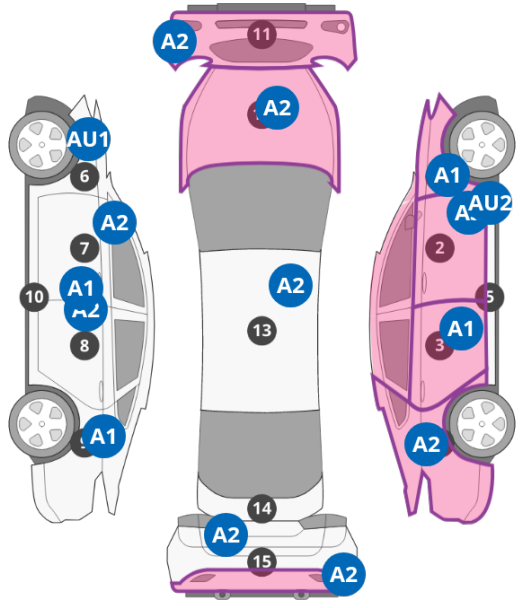
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	<b>188.3</b>	191	180	194
2	Boot Lid	<b>108.0</b>	102	108	114
3	Roof	<b>110.5</b>	125	110	106/101
4	Left Front Fender	<b>109.3</b>	111	112	105
5	Left Front Door	<b>112.0</b>	109	106	121
6	Center Panel Left				
7	Left Rear Door	<b>111.9</b>	133	106	97
8	Left Back Panel	<b>108.1</b>	123	108	94
9	Right Front Fender	<b>214.3</b>	216	215	212
10	Right Front Door	<b>256.3</b>	308	231	230
11	Center Panel Right				
12	Right Rear Door	<b>275.6</b>	233	287	307
13	Right Back Panel	<b>223.5</b>	285	98	288

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / (R) Front Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, no jack and tools, with spare tire, with LTO plate, possible flooding, scratches on tail light</p>