

General Information

Date & Time: 26, Nov, 2025 10:12

Make	Toyota	Model	Avanza
YOM	2023	Odo Meter Reading	144,508
Registration No.	NHC9586	Chassis No.	MHFAA1BY7N0010837
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



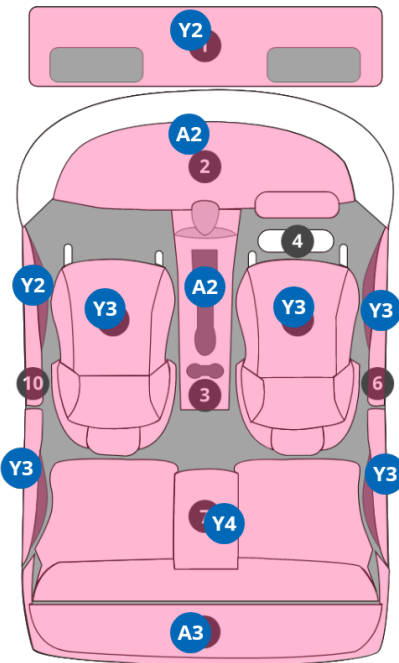
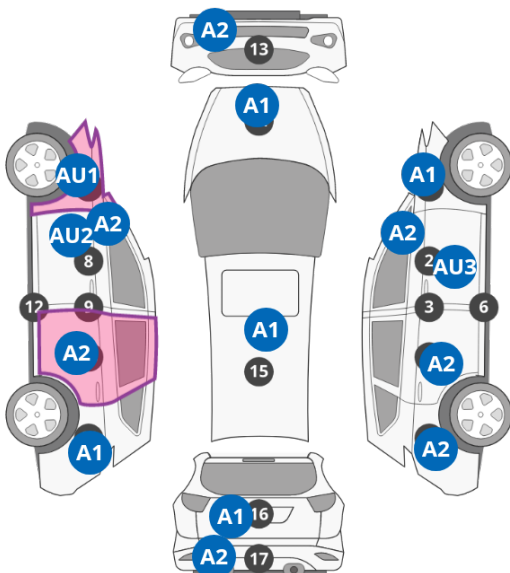
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	117	112	109
2	Boot Lid	108.7	111	119	96
3	Roof	108.8	117	106	97/115
4	Left Front Fender	216.6	335	175	140
5	Left Front Door	112.3	111	108	118
6	Center Panel Left				
7	Left Rear Door	209.0	200	209	218
8	Left Back Panel	108.3	116	106	103
9	Right Front Fender	105.2	114	103	99
10	Right Front Door	107.3	109	106	107
11	Center Panel Right				
12	Right Rear Door	116.0	127	107	114
13	Right Back Panel	108.3	109	104	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Rear Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/with jack and incomplete tools/with reverse camera/No warranty booklet/hazard issue/headlights issue/headlights switch and hazard issue/interior dirty/Possible flooding