

## General Information

Date & Time: 25, Nov, 2025 16:39

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	73,447
<b>Registration No.</b>	NHR1012	<b>Chassis No.</b>	PA1B18F38P4219088
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



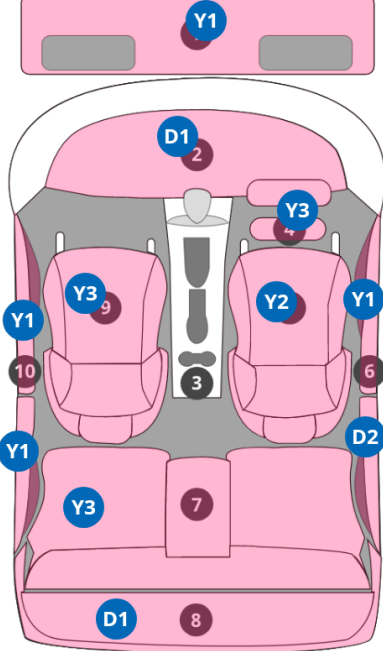
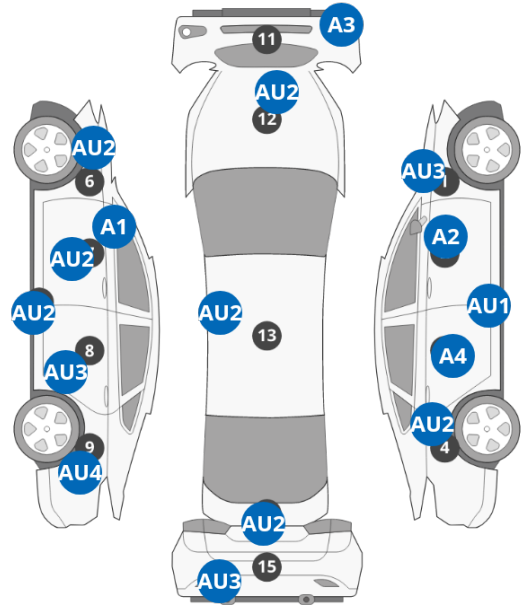
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	188.0	187	184	193
2	Boot Lid	130.3	150	108	133
3	Roof	111.0	110	109	113/112
4	Left Front Fender	112.6	103	116	119
5	Left Front Door	109.6	108	110	111
6	Center Panel Left				
7	Left Rear Door	111.3	113	109	112
8	Left Back Panel	121.6	134	113	118
9	Right Front Fender	120.3	127	118	116
10	Right Front Door	108.3	109	108	108
11	Center Panel Right				
12	Right Rear Door	109.8	105	100	125
13	Right Back Panel	156.6	168	160	142

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Dashboard - Worked - Minimal / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Rear Trim - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Front Seat - Grime - Small / Trunk Room - Worked - Minimal	<b>Remarks</b> Bonnet - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes

<b>Inspector Notes</b>
with LTO plate, with Manual booklet, no warranty booklet, with incomplete tool & jack, with spare tire, with spare key, Plate light issue, no reverse camera, scratches on taillight.