

General Information

Date & Time: 26, Nov, 2025 08:20

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	10,072
Registration No.	NII5314	Chassis No.	MHKA4DF5FNJ077782
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



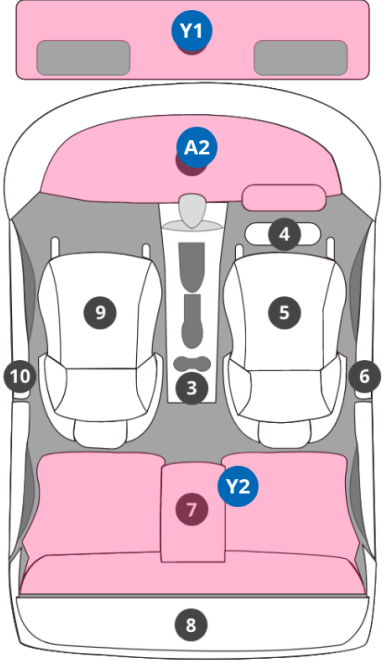
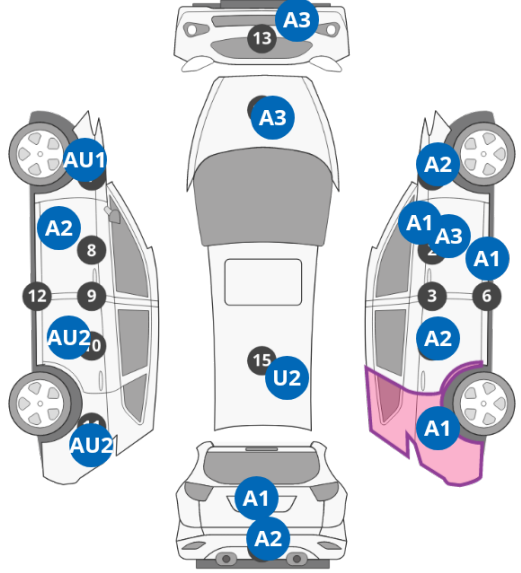
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.4	91	105	90
2	Boot Lid	102.2	84	123	100
3	Roof	91.5	93	88	100/86
4	Left Front Fender	103.9	95	111	106
5	Left Front Door	98.8	102	103	91
6	Center Panel Left				
7	Left Rear Door	97.4	95	100	98
8	Left Back Panel	90.9	93	95	85
9	Right Front Fender	130.6	151	131	110
10	Right Front Door	147.0	127	168	146
11	Center Panel Right				
12	Right Rear Door	131.6	134	131	130
13	Right Back Panel	604.3	188	668	957

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Grime - Small / Ceiling - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Roof - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with spare tire/with spare key/with jack No tools/with reverse camera/with warranty booklet