

General Information

Date & Time: 26, Nov, 2025 13:06

| | | | |
|-------------------------|---------|--------------------------|-------------------|
| Make | Toyota | Model | Avanza |
| YOM | 2025 | Odo Meter Reading | 10,326 |
| Registration No. | NJF2304 | Chassis No. | MHFAA1BY3R0035692 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | MPV |
| Colour | Green | | |

Body / Panel Condition



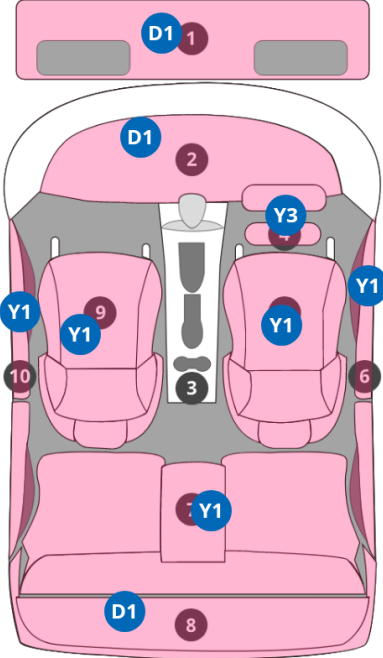
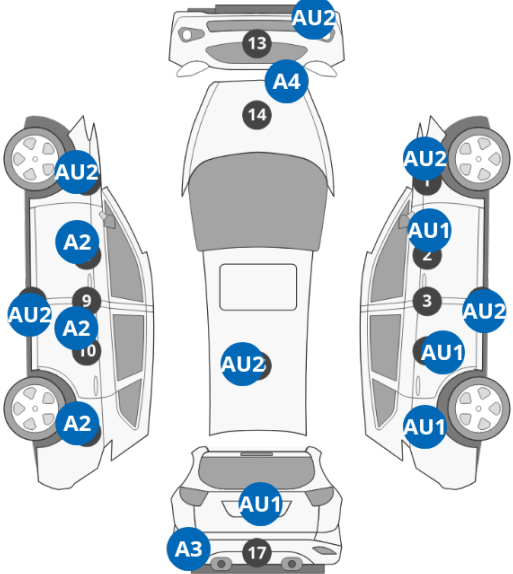
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 110.0 | 115 | 110 | 105 |
| 2 | Boot Lid | 109.6 | 107 | 105 | 117 |
| 3 | Roof | 135.0 | 150 | 123 | 116/151 |
| 4 | Left Front Fender | 109.6 | 106 | 102 | 121 |
| 5 | Left Front Door | 129.6 | 130 | 121 | 138 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 146.0 | 189 | 112 | 137 |
| 8 | Left Back Panel | 131.3 | 132 | 121 | 141 |
| 9 | Right Front Fender | 117.6 | 136 | 113 | 104 |
| 10 | Right Front Door | 131.6 | 157 | 123 | 115 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 119.3 | 119 | 116 | 123 |
| 13 | Right Back Panel | 125.6 | 141 | 108 | 128 |

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| | |
|---|--|
| Interior Evaluation : B | Exterior Evaluation : D |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| Remarks (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Grime - Medium / Dashboard - Worked - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / Trunk Room - Worked - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Ceiling - Crinkle - Minimal | Remarks (L) Rear Door - Repair Traces - Yes / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small |
| Frame Evaluation : A | Functional Evaluation : B |
| Remarks Defects not found | Remarks Battery - Weak - Yes |

| |
|--|
| Inspector Notes |
| with LTO plate, with spare tire & incomplete tools, with jack, with manual and warranty booklet, with reverse camera, with spare key ,taillight scratches. |