

General Information

Date & Time: 26, Nov, 2025 15:42

Make	Toyota	Model	Hiace
YOM	2022	Odo Meter Reading	91,303
Registration No.	NIE5907	Chassis No.	JTFJT02P6N0015655
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



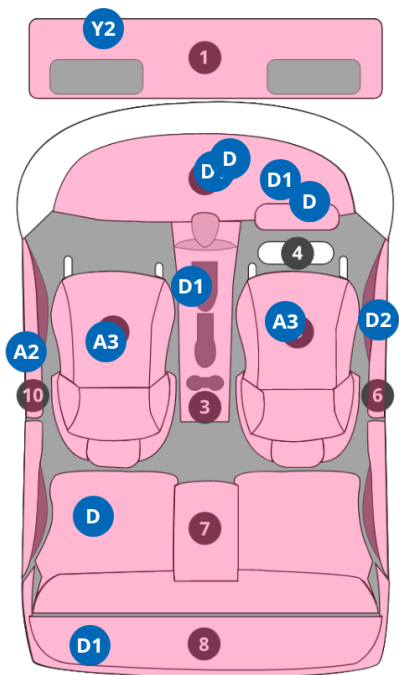
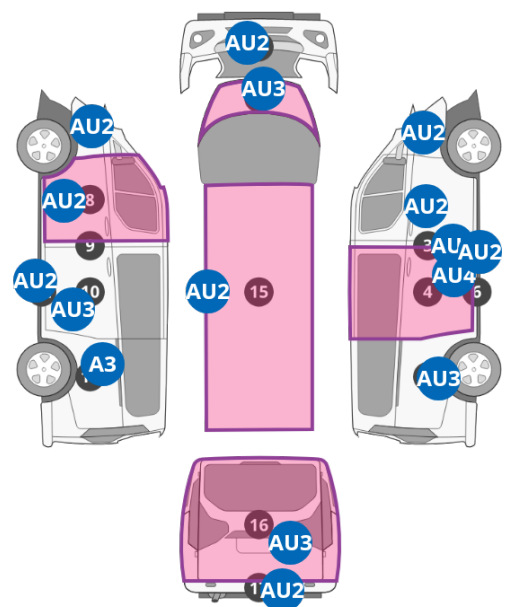
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	136.6	118	142	150
2	Boot Lid	77.0	84	70	78
3	Roof	566.7	796	1,006	245/220
4	Left Front Fender	86.6	77	84	99
5	Left Front Door	74.4	81	73	70
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	138.6	127	183	106
9	Right Front Fender	89.0	71	98	99
10	Right Front Door	82.7	88	74	86
11	Center Panel Right	90.6	111	89	72
12	Right Rear Door	78.4	85	75	75
13	Right Back Panel	78.5	79	76	82

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / Dashboard - Worked - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Cut, Crack - Medium / (L) Front Seat - Cut, Crack - Medium / Rear Seat - Worn - Yes / (L) Front Trim - Cut, Crack - Small / (R) Front Trim - Worked - Small / Glove Box - Worked - Minimal / Trunk Room - Worked - Minimal / Console, Switches, Vents - Worked - Minimal / Glove Box - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Center Panel - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Repair mark - Yes / Roof - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Front Panel - Scratch & Dent - Medium / Front Panel - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with incomplete tools & jack, with spare tire, with manual booklet, no warranty booklet, issue on taillight right crack, issue on brake light, issue on glovebox, no reverse camera.</p>