

## General Information

Date & Time: 28, Nov, 2025 13:39

<b>Make</b>	Nissan	<b>Model</b>	NV350
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	53,859
<b>Registration No.</b>	NFG6317	<b>Chassis No.</b>	JN1TC2E26Z0081376
<b>CC</b>	2.5	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	Gray		

## Body / Panel Condition



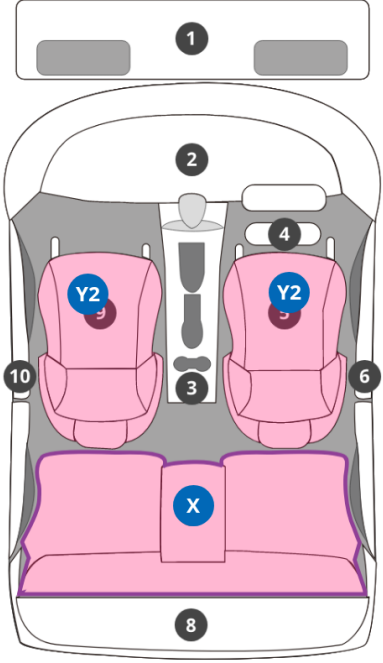
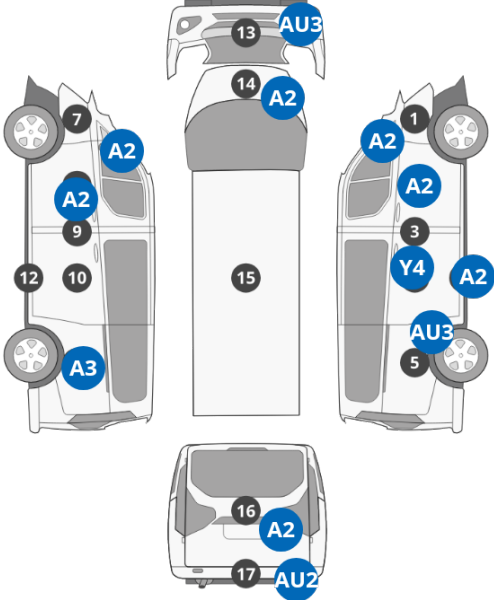
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	104	104	103
2	Boot Lid	112.0	110	122	104
3	Roof	121.5	110	112	109/155
4	Left Front Fender	104.3	103	107	103
5	Left Front Door	111.6	115	107	113
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	115.0	115	117	113
9	Right Front Fender	111.3	111	112	111
10	Right Front Door	114.0	114	113	115
11	Center Panel Right	118.0	130	115	109
12	Right Rear Door	148.6	141	144	161
13	Right Back Panel	180.0	244	147	149

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Partially Missing - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (R) Step - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door, Molding - Crack, Gap - Large / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium / (R) Front Fender, Molding - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Sliding door issue. Rear seat partially missing. With warranty booklet, spare tire. Incomplete seat cover. Without jack and tools. 1 key. With LTO plate.</p>