

## General Information

Date & Time: 05, Dec, 2025 07:46

<b>Make</b>	Toyota	<b>Model</b>	Hiace
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	117,251
<b>Registration No.</b>	DBJ3685	<b>Chassis No.</b>	JTFJT02P9P5034528
<b>CC</b>	3.0	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Van
<b>Colour</b>	White		

## Body / Panel Condition



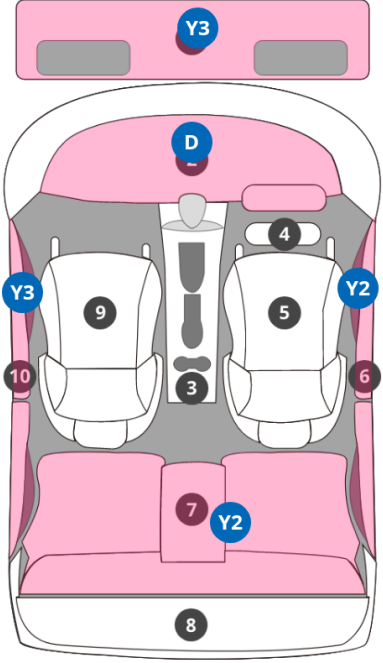
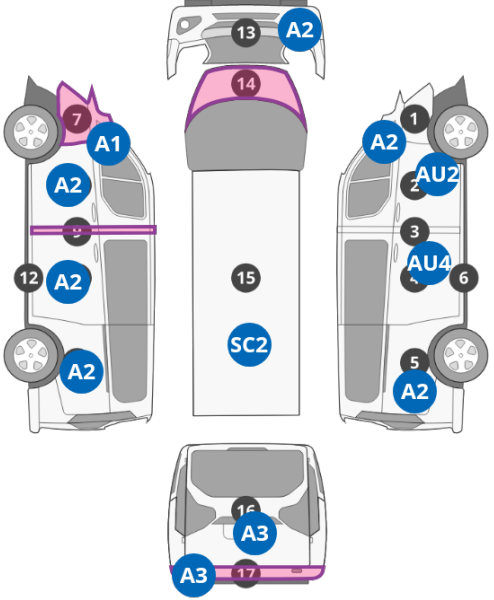
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	113	148	104
2	Boot Lid	68.6	70	76	61
3	Roof	75.6	81	79	72/72
4	Left Front Fender	116.6	150	106	94
5	Left Front Door	65.8	71	65	62
6	Center Panel Left	101.9	75	82	149
7	Left Rear Door	67.5	64	70	69
8	Left Back Panel	68.1	69	65	71
9	Right Front Fender	85.9	82	90	86
10	Right Front Door	64.9	63	63	69
11	Center Panel Right	72.3	80	71	66
12	Right Rear Door	67.2	72	68	63
13	Right Back Panel	77.8	84	73	77

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small</p>	<p><b>Remarks</b> Front Panel - Repair Traces - Yes / (L) Center Panel - Repair Traces - Yes / (L) Center Panel - Repair mark - Yes / Front Panel - Repair mark - Yes / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Rust, Corrosion - Small / Trunk Hood, Rear Gate - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack and tools/No reverse camera/No fog light/left side tail light issue/No warranty booklet/clutch lining issue/windshield minimal crack</p>