

## General Information

Date & Time: 05, Dec, 2025 18:44

<b>Make</b>	Toyota	<b>Model</b>	Corolla Altis
<b>YOM</b>	2016	<b>Odo Meter Reading</b>	97,829
<b>Registration No.</b>	GCS4257	<b>Chassis No.</b>	MR053REH104548193
<b>CC</b>	1.6	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



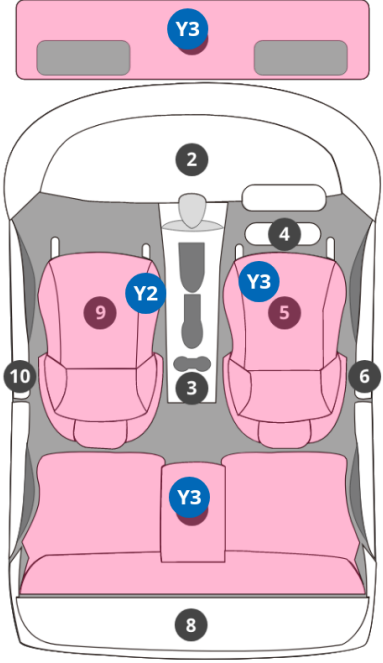
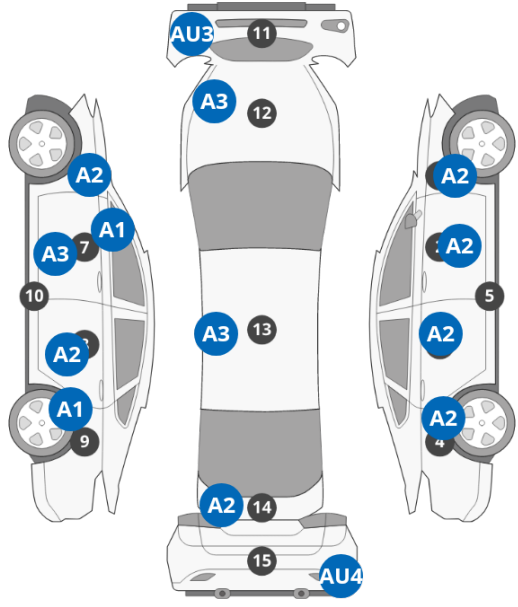
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	87.4	83	92	88
2	Boot Lid	92.7	91	97	91
3	Roof	77.7	75	74	79/83
4	Left Front Fender	117.8	126	129	99
5	Left Front Door	119.3	116	119	123
6	Center Panel Left				
7	Left Rear Door	207.0	229	210	182
8	Left Back Panel	206.6	215	206	199
9	Right Front Fender	119.3	95	134	129
10	Right Front Door	84.5	87	84	83
11	Center Panel Right				
12	Right Rear Door	87.3	83	87	92
13	Right Back Panel	249.6	179	362	208

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Rear left door issue. Trunk floor missing. Without warranty booklet, tools, jack and seat cover. With spare tire. 1 key. With LTO plate.</p>