

General Information

Date & Time: 05, Dec, 2025 13:54

Make	Toyota	Model	Hilux
YOM	2019	Odo Meter Reading	83,235
Registration No.	GAP9047	Chassis No.	MR0GB8DD7J1338934
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



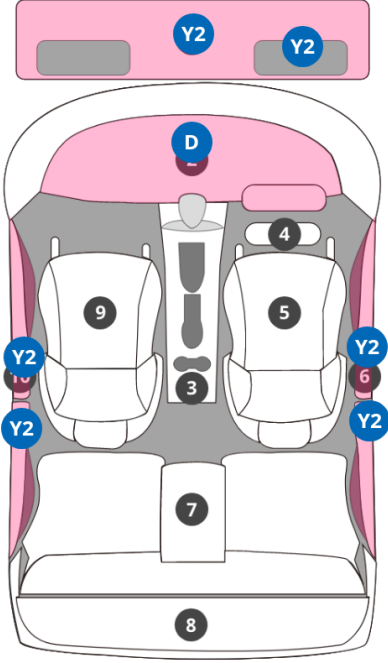
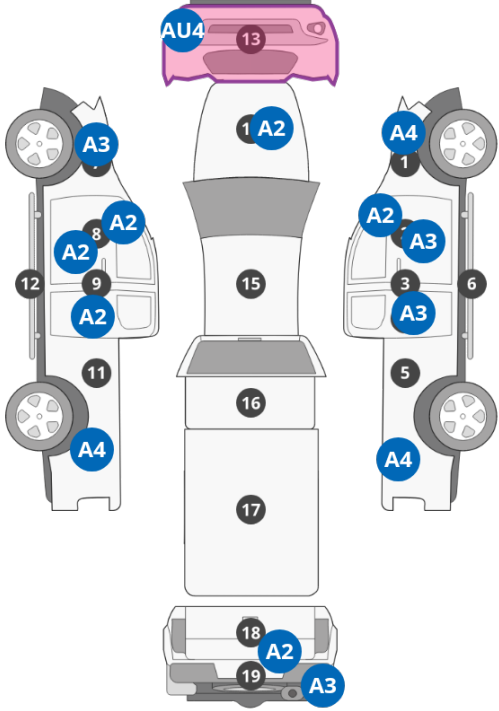
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	178.3	178	180	177
2	Boot Lid	134.0	138	122	142
3	Roof	110.2	100	111	121/109
4	Left Front Fender	206.6	183	174	263
5	Left Front Door	107.0	102	115	104
6	Center Panel Left				
7	Left Rear Door	102.0	107	103	96
8	Left Back Panel	192.3	182	195	200
9	Right Front Fender	280.3	239	235	367
10	Right Front Door	98.1	97	99	99
11	Center Panel Right				
12	Right Rear Door	141.6	146	135	144
13	Right Back Panel	371.3	184	667	263

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Large / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Side Gate - Scratch - Large / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>Engine oil level low indicated at dashboard. No plate light. Right taillight busted. Gap and putty cracks at front bumper. 2 keys. With LTO plate.</p>