

## General Information

Date & Time: 03, Dec, 2025 15:48

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	42,437
<b>Registration No.</b>	NHM2708	<b>Chassis No.</b>	PA1B18F34R424257
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



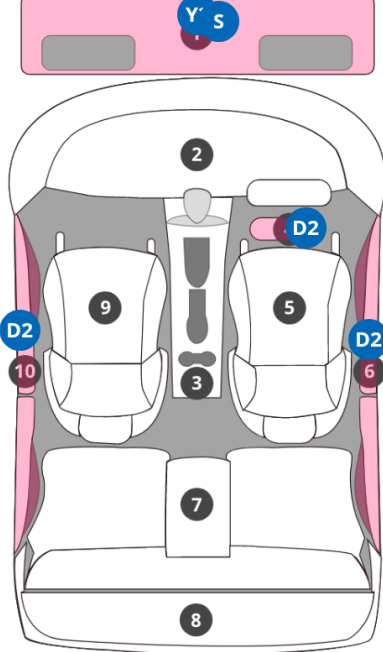
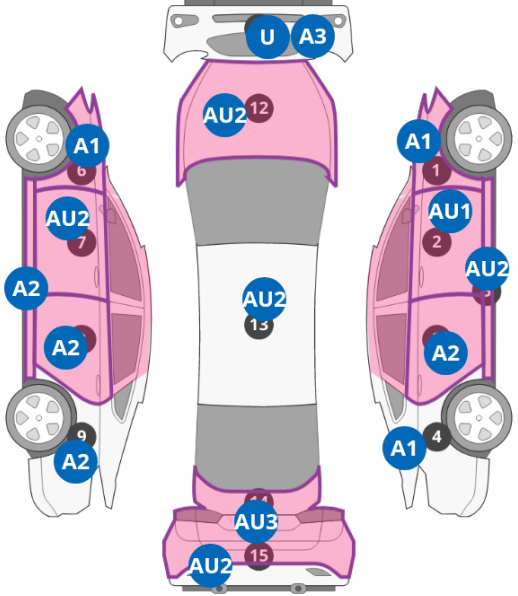
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	126	109	112
2	Boot Lid	109.3	110	106	112
3	Roof	98.6	106	98	97/93
4	Left Front Fender	98.0	100	100	94
5	Left Front Door	99.5	98	101	100
6	Center Panel Left				
7	Left Rear Door	106.0	101	117	100
8	Left Back Panel	111.6	115	110	110
9	Right Front Fender	108.6	108	107	111
10	Right Front Door	109.6	105	109	115
11	Center Panel Right				
12	Right Rear Door	106.3	103	108	108
13	Right Back Panel	115.6	113	113	121

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Worked - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>E</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With LTO plate, No warranty booklet and Spare tire and Jack and Tools, scratch headlight and tail light, no spare key, no reverse camera, foul smell, possible flooded, worn tires, adhesive marks, crack tail light.