

General Information

Date & Time: 05, Dec, 2025 15:50

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	5,009
Registration No.	NHU9696	Chassis No.	MHFAA1BYR0035386
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



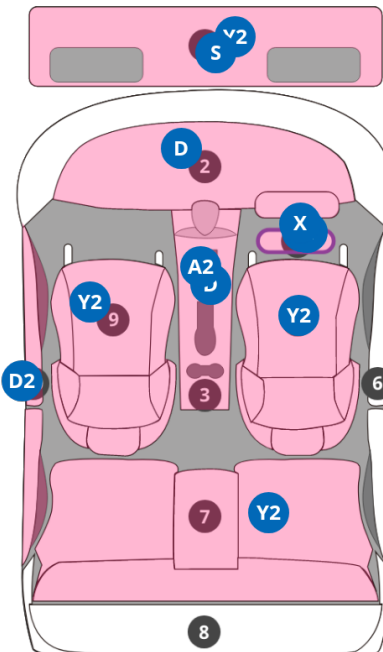
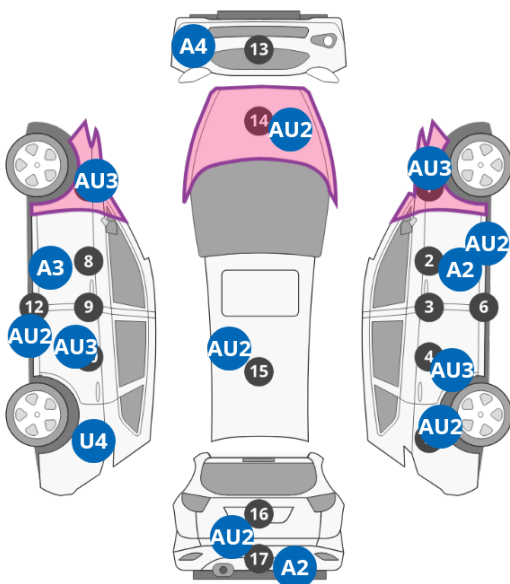
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	109	108	124
2	Boot Lid	112.6	117	116	105
3	Roof	122.0	113	124	126/125
4	Left Front Fender	104.6	105	108	101
5	Left Front Door	122.0	121	121	124
6	Center Panel Left				
7	Left Rear Door	117.3	119	115	118
8	Left Back Panel	121.6	129	125	111
9	Right Front Fender	110.0	112	111	107
10	Right Front Door	116.3	124	117	108
11	Center Panel Right				
12	Right Rear Door	114.0	110	116	116
13	Right Back Panel	117.3	113	109	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No LTO plate, No warranty booklet and Spare tire and Jack and Tools, scratch headlight and tail light, Worn Tires, foul smell, Room light issue and plate light busted, foglight issue.</p>