

General Information

Date & Time: 10, Dec, 2025 15:59

Make	Toyota	Model	Avanza
YOM	2022	Odo Meter Reading	35,271
Registration No.	NFL8037	Chassis No.	MHFAA1BY7N0004696
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Black		

Body / Panel Condition



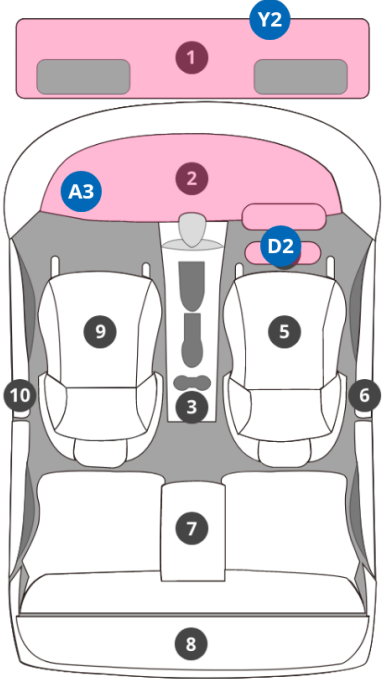
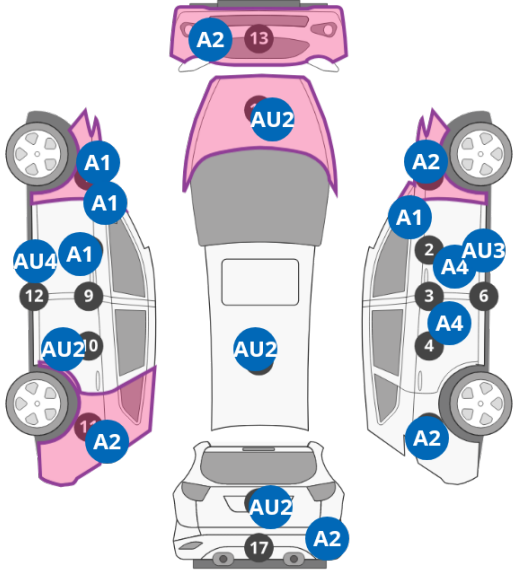
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	148.0	152	138	154
2	Boot Lid	109.6	100	125	104
3	Roof	118.0	107	115	127/123
4	Left Front Fender	127.0	141	121	119
5	Left Front Door	90.8	85	93	95
6	Center Panel Left				
7	Left Rear Door	143.6	139	137	155
8	Left Back Panel	204.3	267	193	153
9	Right Front Fender	104.9	110	107	98
10	Right Front Door	100.7	102	96	104
11	Center Panel Right				
12	Right Rear Door	110.6	112	107	113
13	Right Back Panel	109.8	99	114	116

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / Steering Wheel - Worn, Peel, Crack - Medium</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, No spare key, worn tires and Sparetire, Scratch headlight and tail light, foul smell, plate and room light, side mirror issue.</p>