

General Information

Date & Time: 11, Dec, 2025 15:55

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	20,035
Registration No.	CCG2152	Chassis No.	PA1B18F36R4276084
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



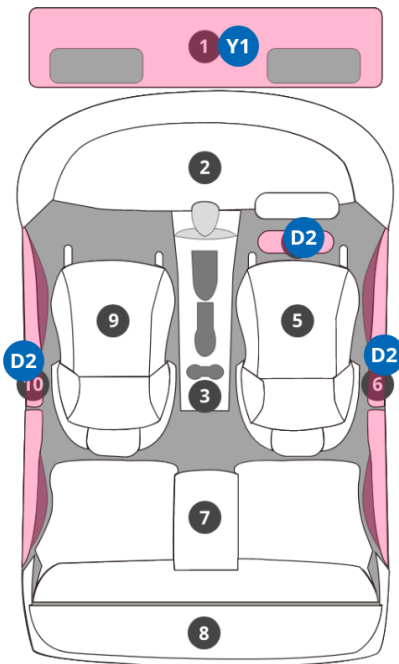
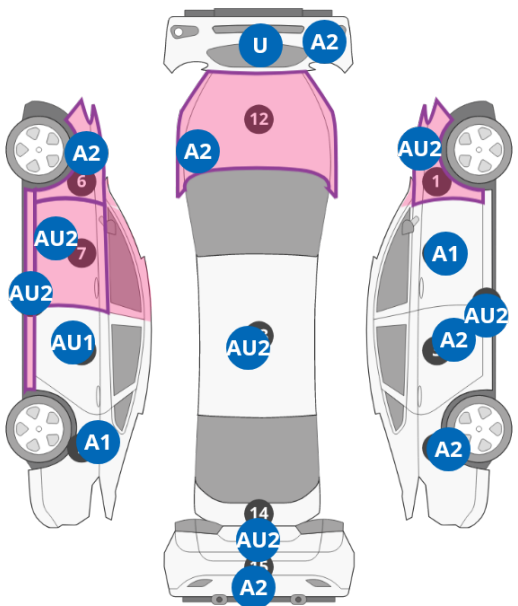
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.3	108	98	101
2	Boot Lid	97.1	90	100	102
3	Roof	91.5	106	90	82/88
4	Left Front Fender	90.7	94	88	90
5	Left Front Door	94.7	94	91	99
6	Center Panel Left				
7	Left Rear Door	97.7	98	94	101
8	Left Back Panel	690.0	168	989	913
9	Right Front Fender	86.8	90	85	86
10	Right Front Door	91.9	91	96	88
11	Center Panel Right				
12	Right Rear Door	96.3	99	95	95
13	Right Back Panel	100.1	97	100	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : D	Functional Evaluation : B
<p>Remarks Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet, No spare key, worn tires, no Tools and Jack and Sparetire, Scratch headlight and tail light, Plate light issue and room light issue.</p>