

## General Information

Date & Time: 09, Dec, 2025 10:56

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2022	<b>Odo Meter Reading</b>	27,722
<b>Registration No.</b>	NFG2958	<b>Chassis No.</b>	MHKA4DF5FMJ062100
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Black		

## Body / Panel Condition



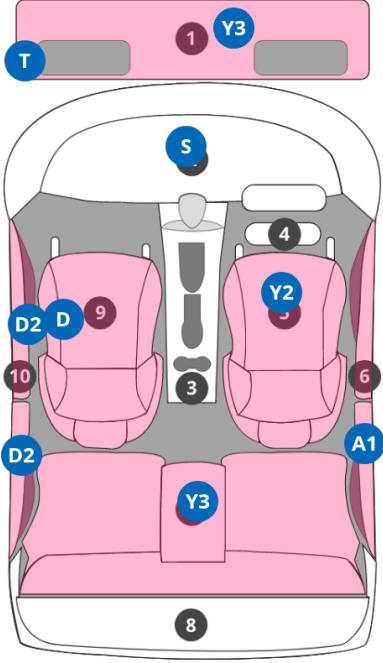
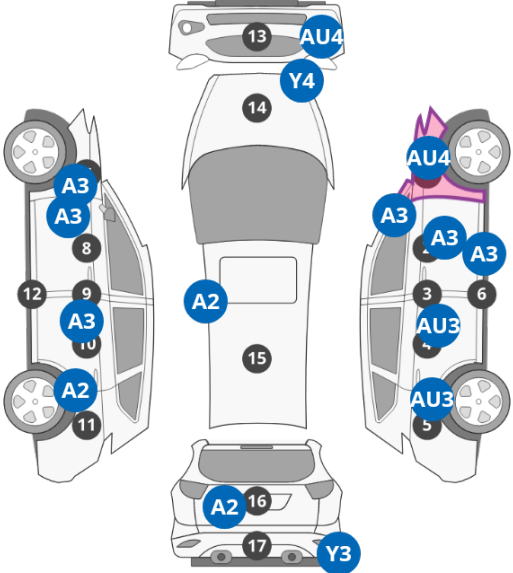
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.3	97	85	75
2	Boot Lid	99.9	96	108	96
3	Roof	85.1	78	88	90/85
4	Left Front Fender	89.0	78	99	91
5	Left Front Door	99.0	103	98	97
6	Center Panel Left				
7	Left Rear Door	95.1	98	95	93
8	Left Back Panel	92.5	95	96	87
9	Right Front Fender	80.8	81	85	77
10	Right Front Door	97.3	96	97	100
11	Center Panel Right				
12	Right Rear Door	99.8	113	97	90
13	Right Back Panel	94.4	96	95	93

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Smell - Yes / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (L) Rear Trim - Worked - Small / (L) Front Trim - Worked - Small / Ceiling - Grime - Medium / Ceiling - Cigarette Burns - Burnt</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Scratch &amp; Dent - Large / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Crack, Gap - Large / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Remote Key &amp; Smart entry - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack, no tools, with spare tire, with LTO plate, scratches on headlight and tail light, front right fender replaced, left side mirror housing replaced, remote key issue</p>