

## General Information

Date & Time: 10, Dec, 2025 15:34

<b>Make</b>	Toyota	<b>Model</b>	Avanza
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	115,477
<b>Registration No.</b>	NIH5276	<b>Chassis No.</b>	MHFAA1BY8N0009292
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	MPV
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



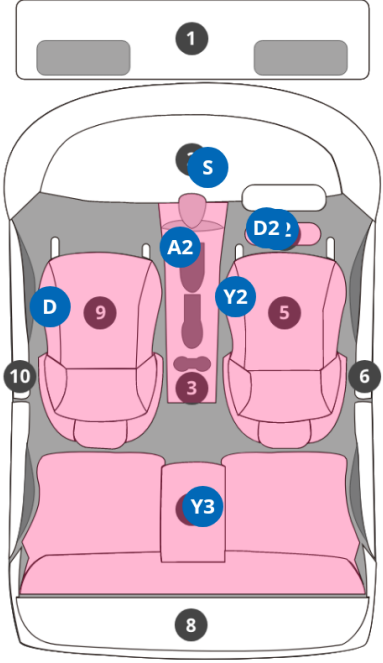
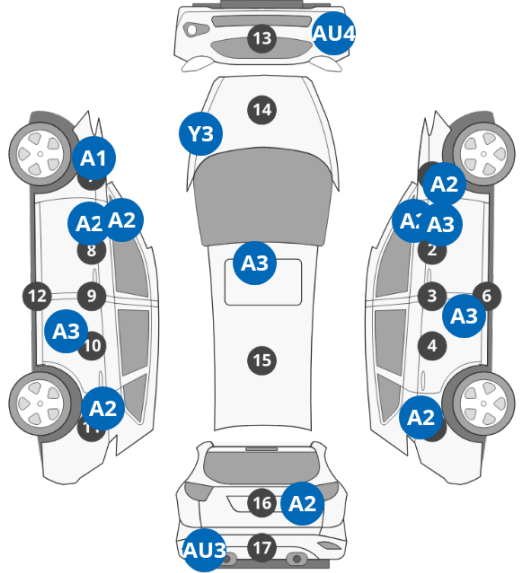
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	119	104	115
2	Boot Lid	113.9	119	126	97
3	Roof	108.7	118	114	98/105
4	Left Front Fender	102.5	100	99	109
5	Left Front Door	113.6	116	112	113
6	Center Panel Left				
7	Left Rear Door	108.3	118	104	103
8	Left Back Panel	114.3	113	112	118
9	Right Front Fender	104.0	110	101	101
10	Right Front Door	105.3	107	105	104
11	Center Panel Right				
12	Right Rear Door	109.0	116	105	106
13	Right Back Panel	118.0	133	102	119

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
	
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>  Overall Interior - Smell - Yes / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / Mat Other - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / Knobs - Worn, Peel, Crack - Small</p>	<p><b>Remarks</b>  (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b>  Defects not found</p>	<p><b>Remarks</b>  Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<b>Inspector Notes</b>
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, possible flooding, fog lamps, plate light and dome light issue, shift knob partially missing