

## General Information

Date & Time: 10, Dec, 2025 16:05

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	81,263
<b>Registration No.</b>	NFQ6280	<b>Chassis No.</b>	PA1B18F39L4127949
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



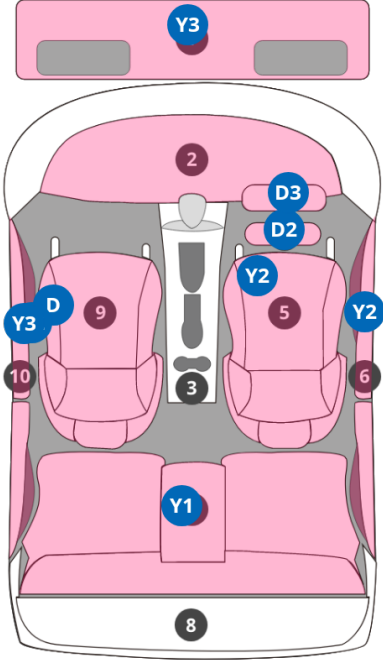
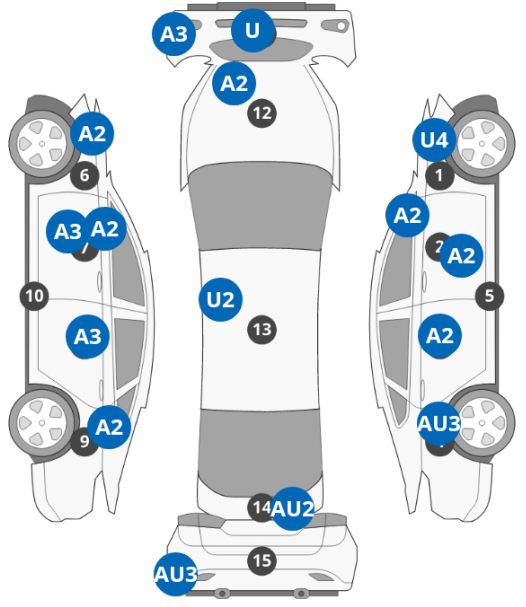
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.5	89	111	117
2	Boot Lid	108.0	112	110	102
3	Roof	102.0	106	102	90/110
4	Left Front Fender	96.0	98	96	94
5	Left Front Door	98.7	99	102	95
6	Center Panel Left				
7	Left Rear Door	173.3	158	182	180
8	Left Back Panel	195.6	231	191	165
9	Right Front Fender	101.7	119	93	93
10	Right Front Door	100.5	104	105	93
11	Center Panel Right				
12	Right Rear Door	96.3	102	96	91
13	Right Back Panel	98.7	96	100	100

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Medium / Rear Seat - Grime - Minimal / Glove Box - Loose, Deformed - Medium</p>	<p><b>Remarks</b> (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, no jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, exhaust pipe issue</p>