

## General Information

Date & Time: 09, Dec, 2025 15:51

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	8,669
<b>Registration No.</b>	DBJ8308	<b>Chassis No.</b>	PA1B18F38P4226543
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Blue		

## Body / Panel Condition



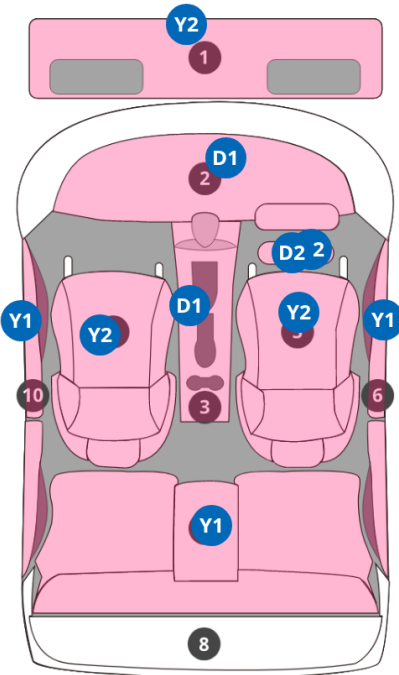
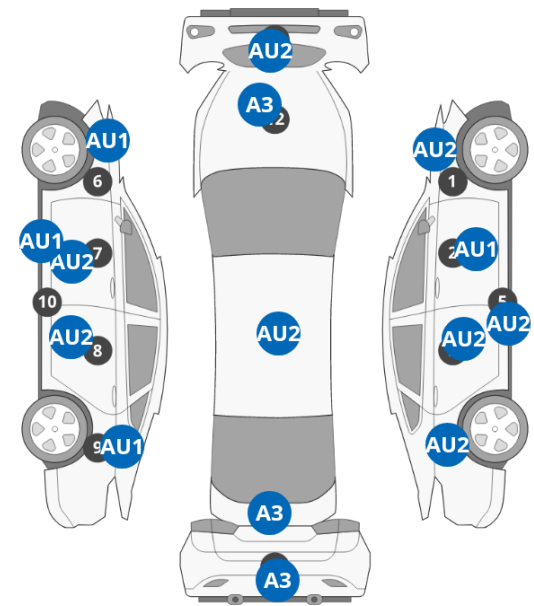
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	114	101	137
2	Boot Lid	106.6	106	109	105
3	Roof	103.7	111	102	100/102
4	Left Front Fender	101.4	94	93	118
5	Left Front Door	136.0	96	206	106
6	Center Panel Left				
7	Left Rear Door	102.9	106	97	106
8	Left Back Panel	112.6	124	111	103
9	Right Front Fender	109.3	125	103	100
10	Right Front Door	104.0	104	104	104
11	Center Panel Right				
12	Right Rear Door	108.0	114	101	109
13	Right Back Panel	106.1	99	101	118

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>D</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Ceiling - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Worked - Minimal / Rear Seat - Grime - Minimal / Console, Switchs, Vents - Worked - Minimal / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal	<b>Remarks</b> (L) Front Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate, with spare tire, with incomplete tools & jack, no spare key, no warranty & manual booklet, no reverse camera, scratches on taillight, scratches on taillight.