

## General Information

Date & Time: 12, Dec, 2025 10:44

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2020	<b>Odo Meter Reading</b>	56,840
<b>Registration No.</b>	NGM1829	<b>Chassis No.</b>	PA1B18F33L4115960
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



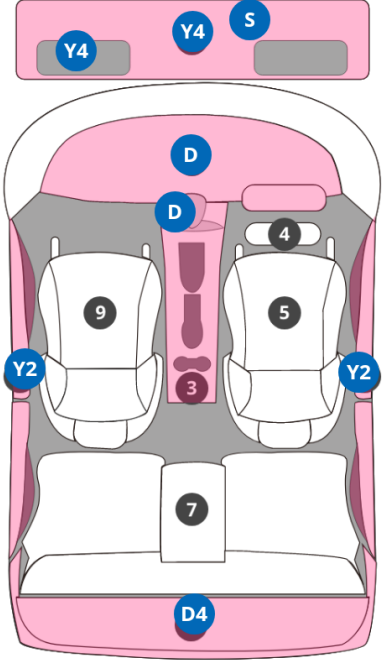
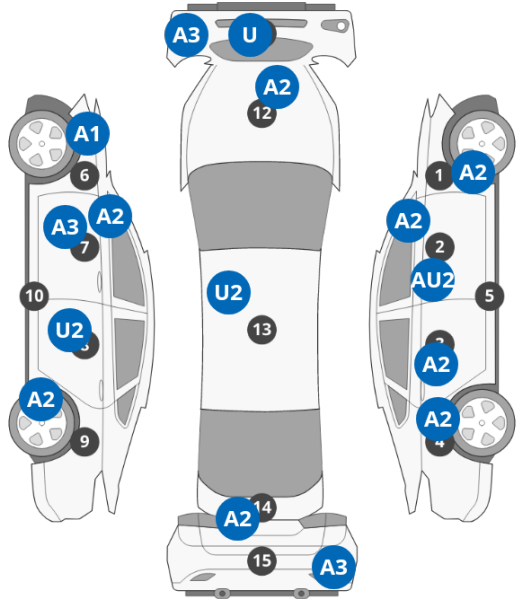
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	163.6	194	153	144
2	Boot Lid	147.3	148	136	158
3	Roof	102.6	116	99	96/99
4	Left Front Fender	109.0	110	109	108
5	Left Front Door	289.0	194	191	482
6	Center Panel Left				
7	Left Rear Door	140.3	149	140	132
8	Left Back Panel	111.6	114	112	109
9	Right Front Fender	247.3	168	235	339
10	Right Front Door	137.0	130	131	150
11	Center Panel Right				
12	Right Rear Door	108.5	100	106	120
13	Right Back Panel	115.6	103	105	139

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Large / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Worked - Large / (L) Front Trim - Grime - Small / Overall Interior - Smell - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Rear Door, Molding - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Possible flooding. Trunk cover missing. Aircon issue. All original matting missing. Foul smell. Without Warranty booklet, jack and tools. With spare tire and seat cover. 1 key. With LTO plate.</p>