

General Information

Date & Time: 15, Dec, 2025 16:40

Make	Mitsubishi	Model	L300
YOM	2018	Odo Meter Reading	114,998
Registration No.	NBP1148	Chassis No.	PAEL65NYHJB007654
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Vehicle
Colour	White		

Body / Panel Condition



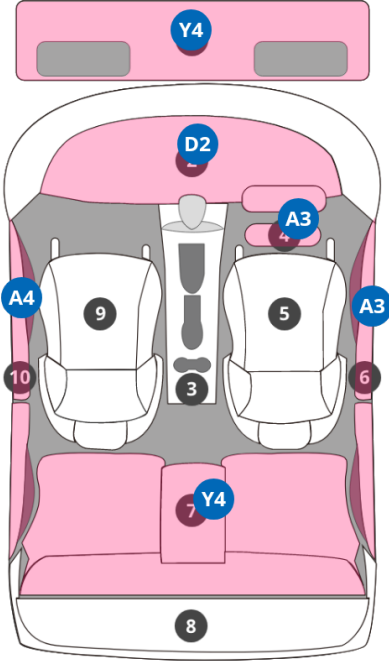
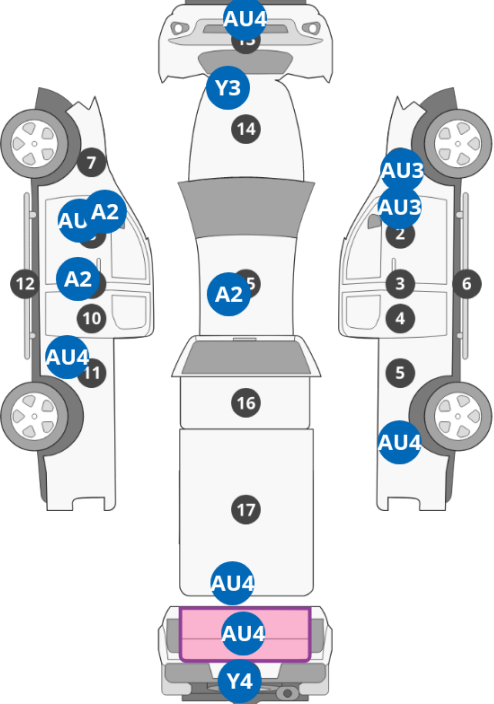
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	60.7	66	56	61
2	Boot Lid	67.1	72	64	66
3	Roof	57.2	59	52	60/58
4	Left Front Fender	68.8	71	67	68
5	Left Front Door	61.4	61	61	62
6	Center Panel Left	76.6	72	80	78
7	Left Rear Door				
8	Left Back Panel	300.9	75	67	761
9	Right Front Fender	74.9	62	103	60
10	Right Front Door	61.7	69	59	58
11	Center Panel Right	76.0	74	72	82
12	Right Rear Door				
13	Right Back Panel	108.0	94	85	145

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Glove Box - Loose, Deformed - Small / (L) Front Trim - Cut, Crack - Large / (R) Front Trim - Cut, Crack - Medium / Carpet - Worn, Scratch, Cut, Crack - Medium / Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Large</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Large / Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Roof - Scratch & Dent - Large / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Cargo Bed Floor - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / (L) Center Panel - Scratch - Small / Overall Exterior - Re-Paint Uneven - Yes</p>
Frame Evaluation : B	Functional Evaluation : D
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Panel, Meter - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, 1key, no warranty booklet, no spare tire, no jack and tools, scratches on headlight and taillight, room mirror Crack, rear gate lock issue, traces of adhesive on body, Antena issue</p>