

## General Information

Date & Time: 12, Dec, 2025 15:41

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	49,688
<b>Registration No.</b>	CCA1384	<b>Chassis No.</b>	PAEA13TJPPA008210
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



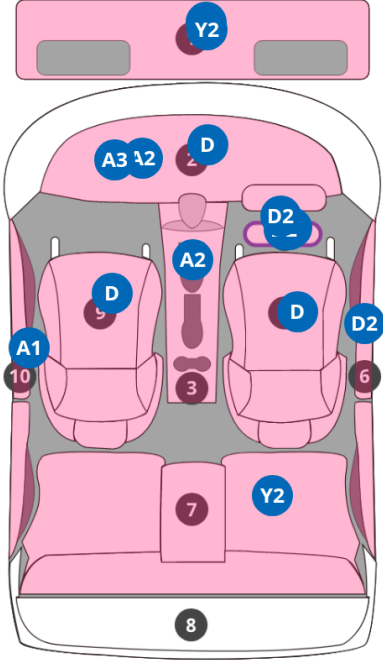
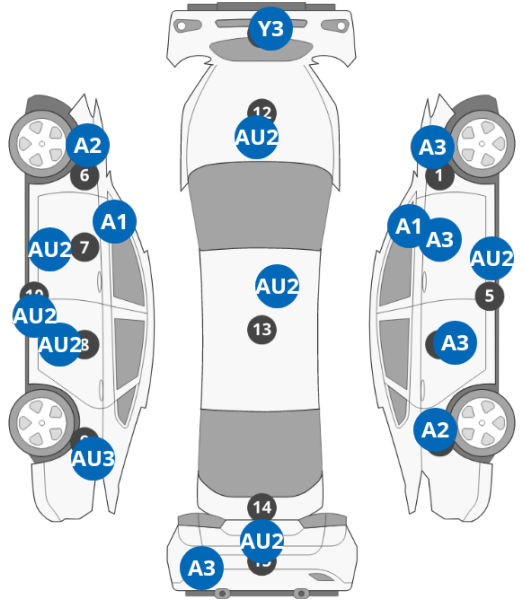
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	124	121	125
2	Boot Lid	110.0	108	120	102
3	Roof	99.7	95	98	101/105
4	Left Front Fender	111.6	115	109	111
5	Left Front Door	112.0	110	116	110
6	Center Panel Left				
7	Left Rear Door	107.3	108	105	109
8	Left Back Panel	121.6	125	121	119
9	Right Front Fender	109.3	106	110	112
10	Right Front Door	110.6	106	110	116
11	Center Panel Right				
12	Right Rear Door	105.0	101	103	111
13	Right Back Panel	123.6	123	120	128

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b>	<b>D</b>	<b>Exterior Evaluation :</b>	<b>E</b>
			
<p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>		<p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>	
<p><b>Remarks</b> (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (L) Front Trim - Cut, Crack - Minimal / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Medium / Overall Interior - Smell - Yes / Ceiling - Grime - Small</p>		<p><b>Remarks</b> Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch &amp; Dent - Small / Roof - Scratch &amp; Dent - Small</p>	
<p><b>Frame Evaluation :</b></p>		<p><b>Functional Evaluation :</b></p>	
<b>A</b>		<b>C</b>	
<p><b>Remarks</b> Defects not found</p>		<p><b>Remarks</b> Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>	

<p><b>Inspector Notes</b></p> <p>With Sparetire, No Tools and Jack and Warranty booklet, No LTO PLATE, No spare, worn tires and Sparetire, No reverse camera, foul smell, possible flooded, warning lamps on, scratch headlight and tail light crack, plate light and Room light issue.</p>
---