

## General Information

Date & Time: 12, Dec, 2025 15:39

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2018	<b>Odo Meter Reading</b>	55,121
<b>Registration No.</b>	NBP8322	<b>Chassis No.</b>	PAEA23TJJA003934
<b>CC</b>	1.2	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



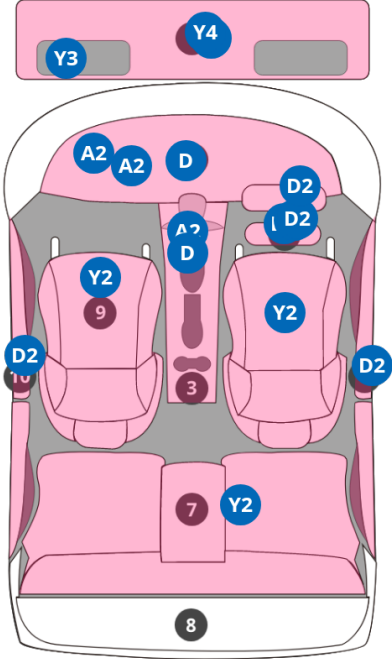
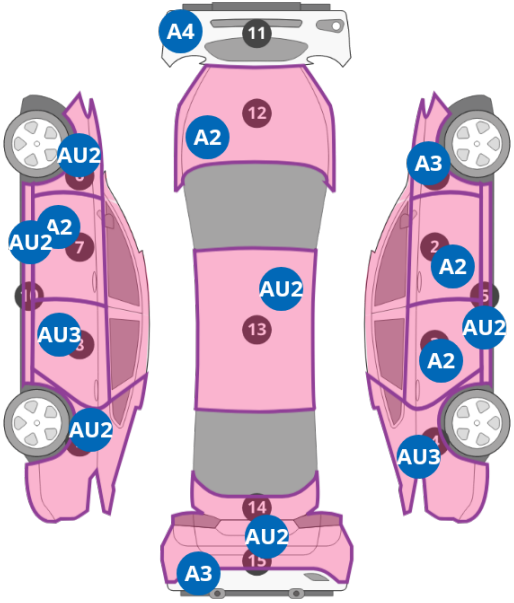
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	100	113	109
2	Boot Lid	508.0	154	147	1,223
3	Roof	97.5	102	92	100/97
4	Left Front Fender	97.2	106	89	97
5	Left Front Door	96.7	93	99	98
6	Center Panel Left				
7	Left Rear Door	110.6	111	115	106
8	Left Back Panel	161.3	110	140	234
9	Right Front Fender	98.6	91	107	98
10	Right Front Door	99.8	98	100	102
11	Center Panel Right				
12	Right Rear Door	100.3	95	100	107
13	Right Back Panel	868.0	1,075	834	695

**Overall Evaluation :**

E

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b></p> <p>Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Large / Sunvisor, Sunglass Holder - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Loose, Deformed - Small</p>	<p><b>Remarks</b></p> <p>(R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Roof - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>E</b></span>
<p><b>Remarks</b></p> <p>Right Front Pillar - Condition of Welding ? - Yes</p>	<p><b>Remarks</b></p> <p>Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

**Inspector Notes**

With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, No spare key, no reverse camera, foul smell, possible flooded, warning lamps on, headlight and tail light crack and Scratch, worn tires and Sparetire, Room light and Plate light issue, air-conditioned issue, headlight and tail light busted, Abnormal vibration on engine, Abnormal shiftshock and noise, window switch issue.