

General Information

Date & Time: 13, Dec, 2025 11:01

Make	MG	Model	GT
YOM	2024	Odo Meter Reading	12,959
Registration No.	GBE9284	Chassis No.	LSJA36U94PN217649
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



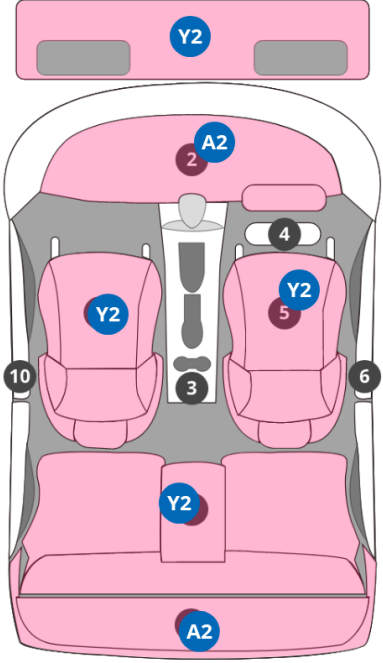
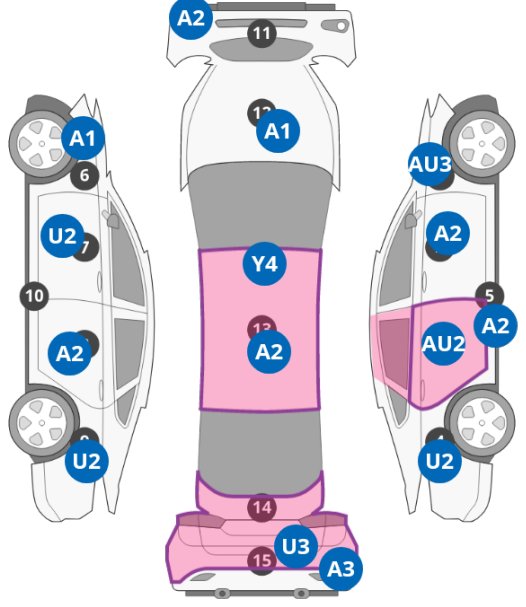
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.3	112	140	139
2	Boot Lid	549.0	203	266	1,178
3	Roof	256.5	140	130	294/462
4	Left Front Fender	134.0	119	143	140
5	Left Front Door	135.3	139	138	129
6	Center Panel Left				
7	Left Rear Door	132.3	143	129	125
8	Left Back Panel	148.3	142	151	152
9	Right Front Fender	134.3	144	138	121
10	Right Front Door	130.6	121	127	144
11	Center Panel Right				
12	Right Rear Door	121.6	112	129	124
13	Right Back Panel	134.3	141	131	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / Front Windshield - Damaged - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack and tools/plate light issue/with check engine /with warranty booklet/door handle issue/roof repainted/trunk hood repainted/right side rear door repainted/head unit issue/rear view mirror issue/front windshield crack large /audio radio issue/reverse camera issue</p>