

General Information

Date & Time: 08, Jan, 2026 15:17

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	20,964
Registration No.	GBH2819	Chassis No.	MHFAA1BY8P0018559
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



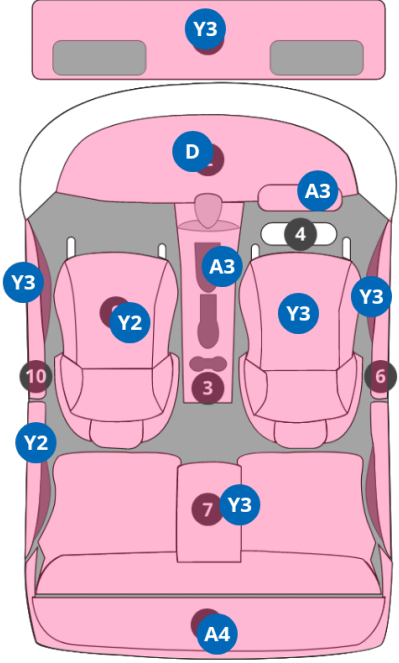
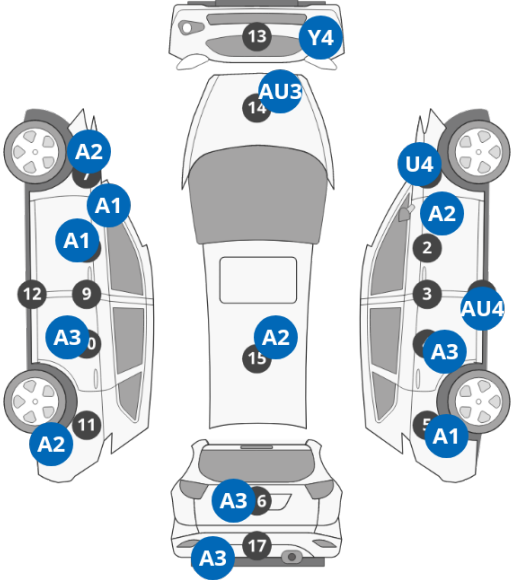
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	105	109	115
2	Boot Lid	97.3	106	99	87
3	Roof	115.5	114	121	118/109
4	Left Front Fender	95.8	100	89	98
5	Left Front Door	113.3	100	119	121
6	Center Panel Left				
7	Left Rear Door	110.6	116	107	109
8	Left Back Panel	106.9	116	106	99
9	Right Front Fender	101.9	111	100	95
10	Right Front Door	143.6	110	101	220
11	Center Panel Right				
12	Right Rear Door	110.3	105	110	116
13	Right Back Panel	104.4	101	99	113

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Large / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / (L) Front Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Fender, Molding - Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate /with spare tire/with 1 spare key/with reverse camera/No jack and tools/with warranty booklet/front right side door issue/front right side headlight issue/ possible flooding/interior dirty</p>