

## General Information

Date & Time: 13, Dec, 2025 10:40

<b>Make</b>	Mitsubishi	<b>Model</b>	Mirage
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	13,958
<b>Registration No.</b>	NKM1826	<b>Chassis No.</b>	PAE13RJSRA004150
<b>CC</b>	1.2	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



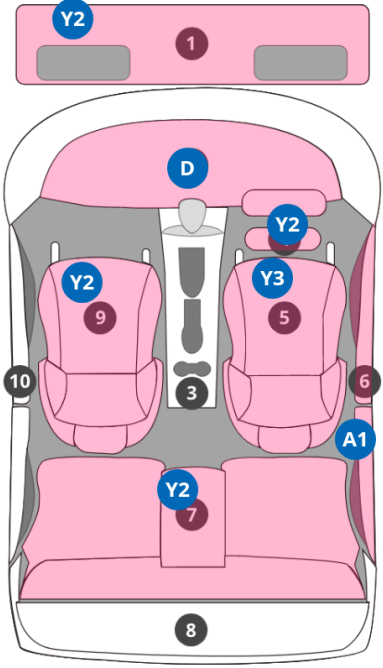
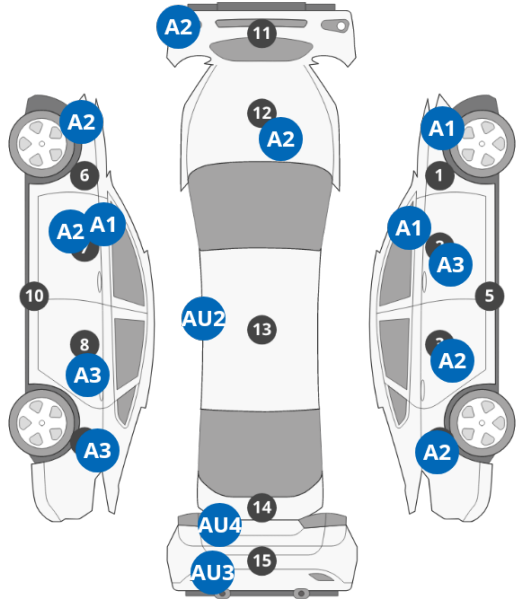
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	133.3	140	131	129
2	Boot Lid	107.0	102	110	109
3	Roof	116.2	101	129	113/122
4	Left Front Fender	115.3	110	120	116
5	Left Front Door	110.3	108	114	109
6	Center Panel Left				
7	Left Rear Door	109.6	110	111	108
8	Left Back Panel	127.3	134	127	121
9	Right Front Fender	124.6	128	120	126
10	Right Front Door	123.3	127	124	119
11	Center Panel Right				
12	Right Rear Door	121.3	120	118	126
13	Right Back Panel	125.0	132	123	120

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a :</b> Cut, Fray <b>d :</b> Loose, Deformed <b>k :</b> Animal Hair <b>s :</b> Smell <b>t :</b> Cigarette Burns <b>x :</b> Defective <b>y :</b> Stain</p>	 <p><b>A :</b> Scratch <b>AU :</b> Scratch &amp; Dent <b>B :</b> Modified <b>C :</b> Corrosion <b>G :</b> Stone chip <b>P :</b> Faded <b>S :</b> Rust <b>SC :</b> Rust &amp; Corrosion <b>U :</b> Dent <b>X :</b> Defective <b>Y :</b> Crack, Gap</p>
<p><b>Remarks</b> (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / Ceiling - Grime - Small / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Floor Mat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light</p>