

General Information

Date & Time: 15, Dec, 2025 14:02

Make	Toyota	Model	Vios
YOM	2017	Odo Meter Reading	88,554
Registration No.	DAB5270	Chassis No.	PA1B19F32H4019881
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



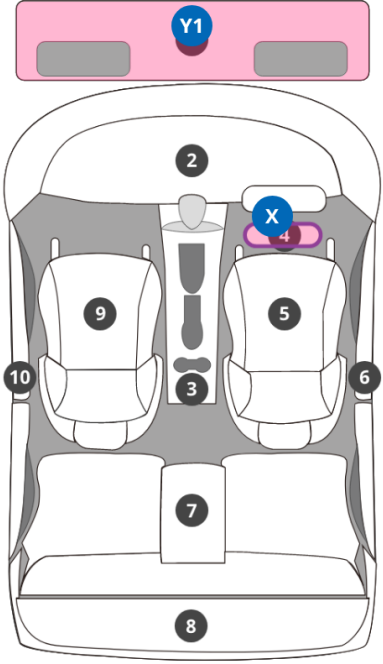
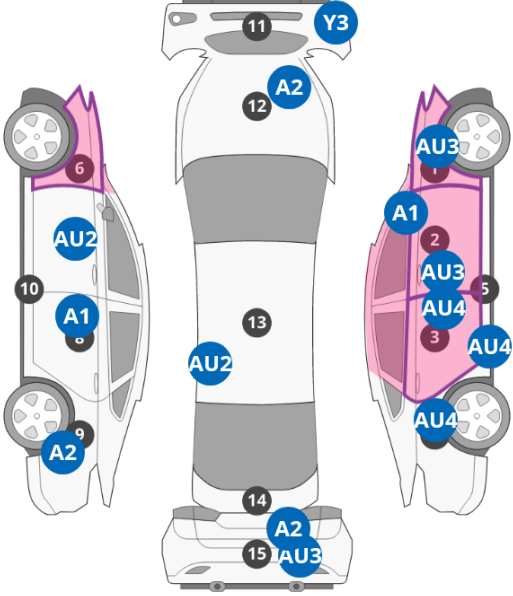
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	102	113	113
2	Boot Lid	122.0	127	116	123
3	Roof	104.5	102	111	102/103
4	Left Front Fender	277.0	353	240	238
5	Left Front Door	113.0	113	118	108
6	Center Panel Left				
7	Left Rear Door	108.6	107	104	115
8	Left Back Panel	109.3	106	108	114
9	Right Front Fender	209.0	181	207	239
10	Right Front Door	891.6	940	641	1,094
11	Center Panel Right				
12	Right Rear Door	397.3	729	225	238
13	Right Back Panel	113.6	115	103	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Minimal / Mat Other - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with jack and spare tire, 1key, no warranty booklet, no tools, scratches on headlights and taillight,