

General Information

Date & Time: 15, Dec, 2025 14:01

Make	Mitsubishi	Model	Mirage
YOM	2019	Odo Meter Reading	78,837
Registration No.	DAN5700	Chassis No.	PAEA13TJKKA012655
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



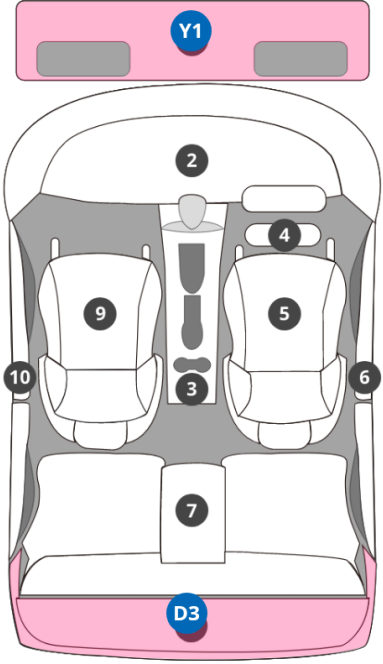
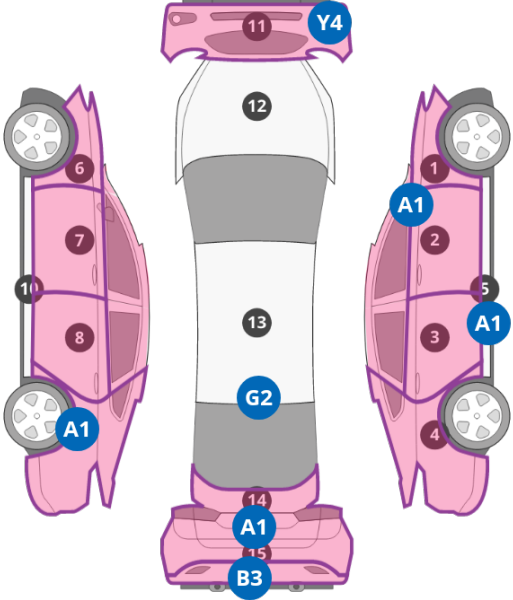
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	187.0	178	223	160
2	Boot Lid	157.3	160	154	158
3	Roof	207.2	154	167	358/150
4	Left Front Fender	516.0	828	516	204
5	Left Front Door	169.6	192	157	160
6	Center Panel Left				
7	Left Rear Door	166.0	167	158	173
8	Left Back Panel	601.3	558	238	1,008
9	Right Front Fender	591.3	254	389	1,131
10	Right Front Door	432.3	267	292	738
11	Center Panel Right				
12	Right Rear Door	363.6	269	225	597
13	Right Back Panel	173.0	175	155	189

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Grime - Minimal / Trunk Room - Loose, Deformed - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Modified - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / Rear Windshield - Scratch, Stone chip - Small / (R) Front Fender, Molding - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with warranty booklet, 1key, with spare tire, no jack and tools