

General Information

Date & Time: 13, Jan, 2026 08:01

Make	MG	Model	ZS
YOM	2020	Odo Meter Reading	73,183
Registration No.	LAI2608	Chassis No.	LSJW74U32LZ022145
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



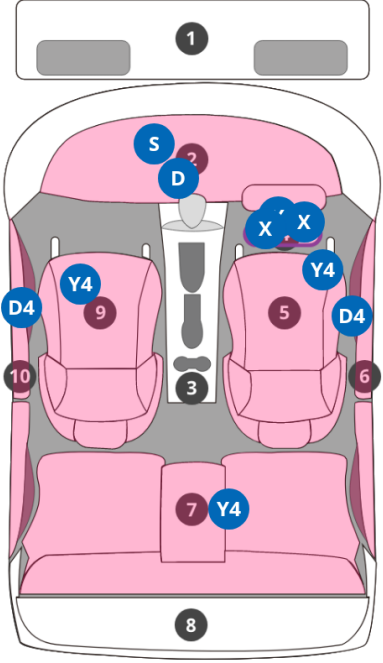
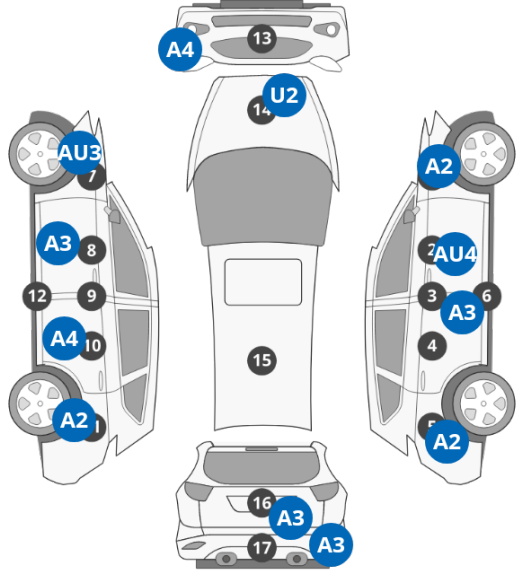
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	126	111	115
2	Boot Lid	131.0	124	149	120
3	Roof	109.2	106	113	106/112
4	Left Front Fender	116.0	114	118	116
5	Left Front Door	119.0	123	117	117
6	Center Panel Left				
7	Left Rear Door	111.0	111	115	107
8	Left Back Panel	117.0	113	114	124
9	Right Front Fender	109.3	106	114	108
10	Right Front Door	112.3	112	111	114
11	Center Panel Right				
12	Right Rear Door	113.0	115	111	113
13	Right Back Panel	117.6	118	119	116

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Worked - Large / (R) Front Trim - Worked - Large / Overall Interior - Smell - Yes</p>	<p>Remarks Bonnet, Headlight - Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ possible flooding / head light issue/ dirty interior/ no tools and jack/ with spare tire and LTO plate/</p>