

## General Information

Date & Time: 20, Dec, 2025 13:16

<b>Make</b>	Suzuki	<b>Model</b>	APV
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	3,742
<b>Registration No.</b>	LAQ1603	<b>Chassis No.</b>	MHYDN71V9SJ400783
<b>CC</b>	1.6	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Van
<b>Colour</b>	Silver		

## Body / Panel Condition



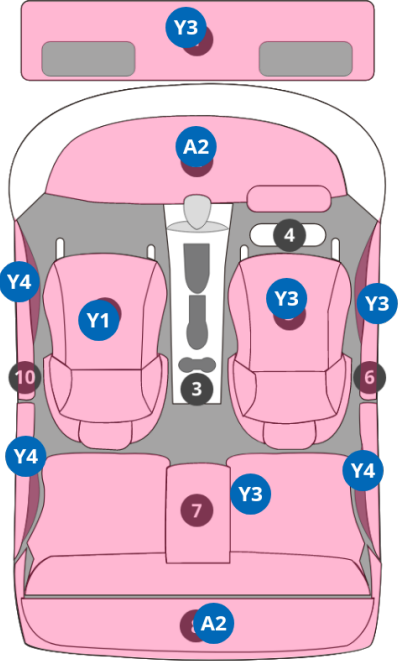
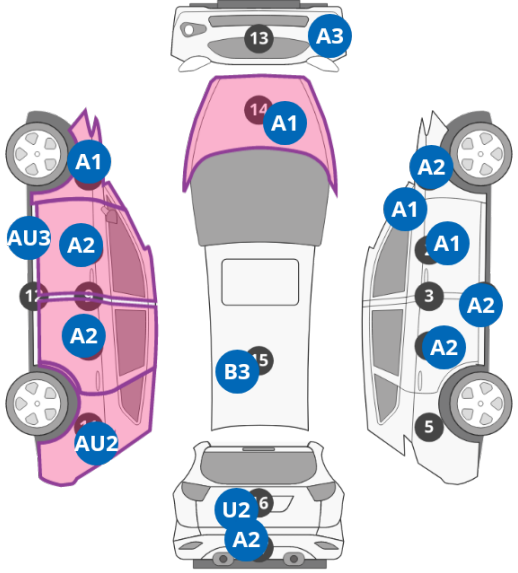
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	521.3	301	983	280
2	Boot Lid	110.3	118	115	98
3	Roof	113.8	93	175	107/81
4	Left Front Fender	438.6	352	523	441
5	Left Front Door	278.6	357	234	245
6	Center Panel Left				
7	Left Rear Door	445.0	876	288	171
8	Left Back Panel	114.3	115	113	115
9	Right Front Fender	248.3	187	279	279
10	Right Front Door	115.6	144	99	104
11	Center Panel Right				
12	Right Rear Door	112.6	113	112	113
13	Right Back Panel	103.4	101	98	111

## Overall Evaluation :

**E**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Large / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Minimal / Ceiling - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch &amp; Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Modified - Medium</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">B</span>
<p><b>Remarks</b> Front Cross Member Support - Condition of Welding ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/No warranty booklet/No reverse camera/No jack and tools/headlight issue/bonnet partial parts missing/No fog light/bonnet hood issue/speaker issue</p>