

General Information

Date & Time: 20, Dec, 2025 14:02

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	31,691
Registration No.	NKA2585	Chassis No.	PAEA13TJRRRA025507
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



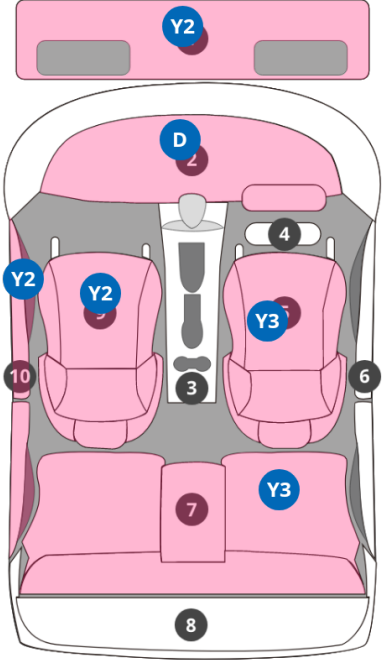
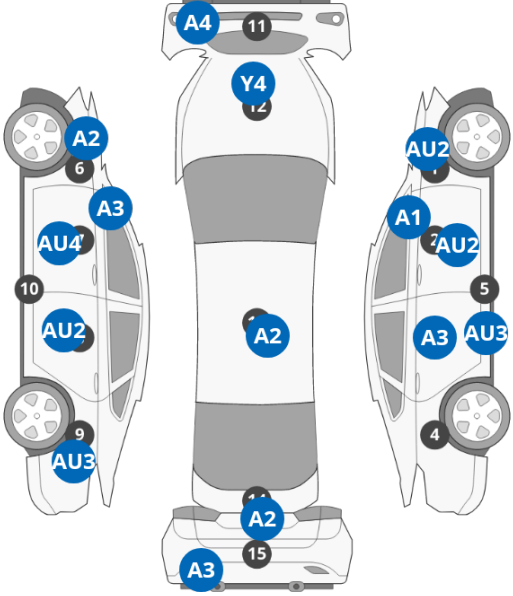
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	178.6	185	185	166
2	Boot Lid	170.3	162	179	170
3	Roof	174.2	178	176	170/173
4	Left Front Fender	162.0	150	177	159
5	Left Front Door	167.3	170	163	169
6	Center Panel Left				
7	Left Rear Door	164.3	172	161	160
8	Left Back Panel	172.0	176	174	166
9	Right Front Fender	177.6	196	168	169
10	Right Front Door	178.6	177	177	182
11	Center Panel Right				
12	Right Rear Door	165.3	152	167	177
13	Right Back Panel	169.0	175	160	172

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Crack, Gap - Large / Front Bumper, Grille, Lamps - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>1 LTO plate only/with spare tire/No spare key/No warranty booklet/No reverse camera/with jack No tools/No fog light</p>