

General Information

Date & Time: 05, Jan, 2026 15:22

Make	Hyundai	Model	H100
YOM	2025	Odo Meter Reading	25,771
Registration No.	NKK5041	Chassis No.	KMFZBX7KASU166199
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Shuttle
Colour	White		

Body / Panel Condition



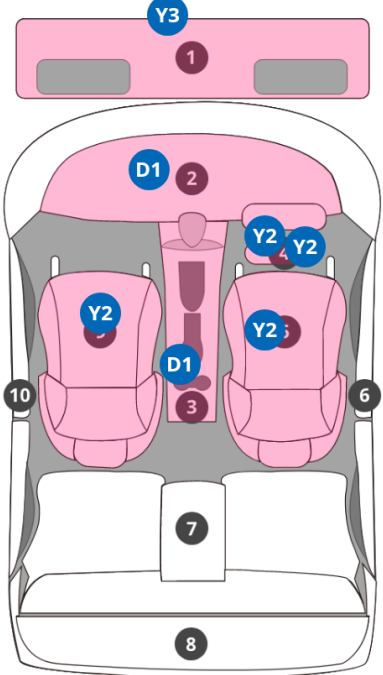
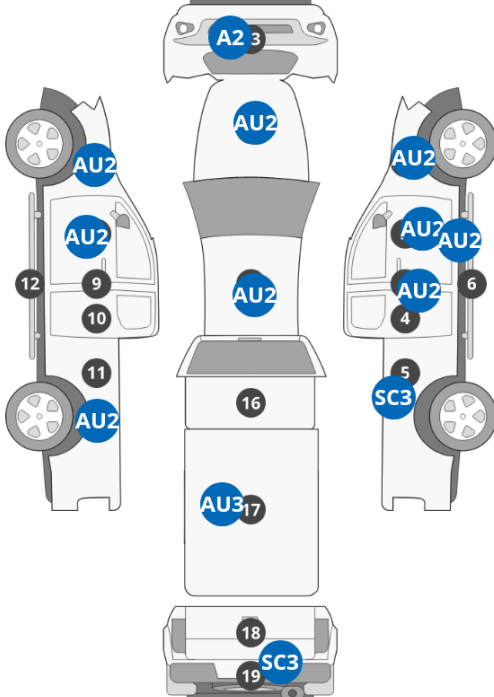
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	74.3	72	78	73
2	Boot Lid	111.0	109	120	104
3	Roof	86.7	80	80	94/93
4	Left Front Fender	100.8	79	101	123
5	Left Front Door	79.8	79	76	85
6	Center Panel Left	87.7	77	99	86
7	Left Rear Door				
8	Left Back Panel	139.6	174	102	143
9	Right Front Fender	83.7	85	74	92
10	Right Front Door	76.7	80	77	73
11	Center Panel Right	85.7	86	83	88
12	Right Rear Door				
13	Right Back Panel	129.0	150	104	133

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Medium / Console, Switchs, Vents - Worked - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Worked - Minimal / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Panel - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Small / (R) Side Gate - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Rust, Corrosion - Medium / Roof - Scratch & Dent - Small / Cargo Bed Floor - Scratch & Dent - Medium / (L) Side Gate - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty & manual booklet, with spare tire, with jack, no reverse camera, no tools, scratches on taillight & headlight.</p>