

General Information

Date & Time: 13, Jan, 2026 08:21

Make	Mitsubishi	Model	L300
YOM	2025	Odo Meter Reading	21,972
Registration No.	NKK9664	Chassis No.	PAEL65MYSRB026175
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



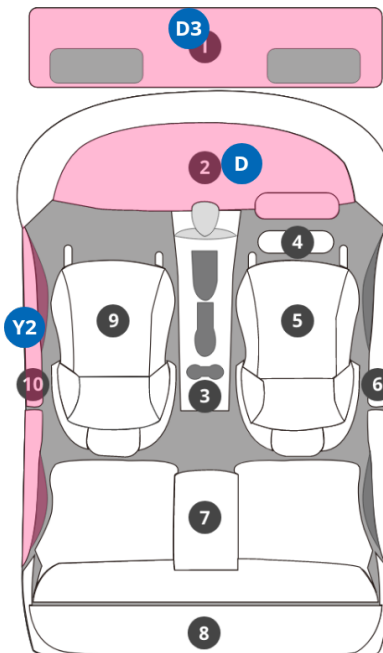
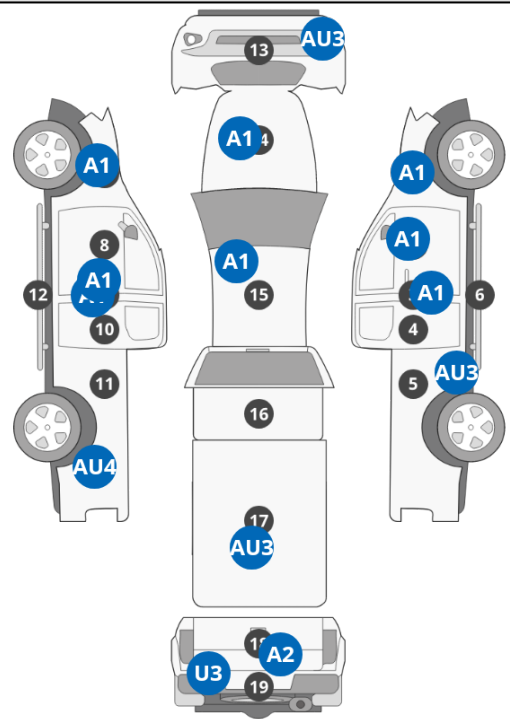
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	83.3	65	95	90
2	Boot Lid	59.4	60	56	61
3	Roof	85.3	67	138	75/62
4	Left Front Fender	92.6	114	86	78
5	Left Front Door	68.3	67	69	69
6	Center Panel Left	84.4	88	83	82
7	Left Rear Door				
8	Left Back Panel	224.0	168	208	296
9	Right Front Fender	78.2	78	81	76
10	Right Front Door	65.8	67	64	66
11	Center Panel Right	78.7	76	90	70
12	Right Rear Door				
13	Right Back Panel	203.0	179	194	236

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Crinkle - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / Cargo Bed Floor - Scratch & Dent - Medium / Rear Gate - Scratch - Small / (L) Side Gate - Scratch & Dent - Large / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Front Panel - Scratch - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, jack and tools, with spare tire, with LTO plate, scratched and cracked tail light</p>